


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHED:

Corner originally established by W. B. Barr under GLO contract number 388 dated May 7, 1881. Surveyor General field notes state:
Marked basalt rock 16x16x12 for 1/4 sec. corner, from which:
A Tamarack 10 in. diam bears N60°E 46 lks dist
A Fir 12 in. diam bears S15°W 13 lks dist

T 5 S R 38 E C-21

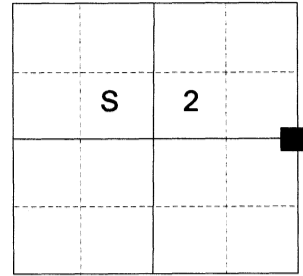

DESCRIPTION OF CORNER EVIDENCE FOUND:

None.

SEE SURVEY 035-2020

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO MONUMENT THE ORIGINAL LOCATION OF THIS CORNER:

At proportionate position I set a 2 1/2" x 30" aluminum pipe, 23" in the ground, with 3" aluminum cap marked as shown below, in a 2 ft. mound of stone,
From which:


NEW BEARING OBJECTS:

- A 6" Douglas Fir bears North 65° East a dist. of 14.50 ft., marked 1/4 S1 BT.
- A 13" Douglas Fir bears South 6° East a dist. of 34.95 ft., marked 1/4 S1 BT.
- A 4" White Fir bears South 23° West a dist. of 17.45 ft., marked 1/4 S2 BT.
- A 12" Douglas Fir bears North 26° West a dist. of 21.95 ft., marked 1/4 S2 BT.

Placed steel fence post approx. 1 ft. North of the aluminum cap.

I hereby certify that the corner was monumented on September 3, 2020.

Witness: Kyle A. Tucker

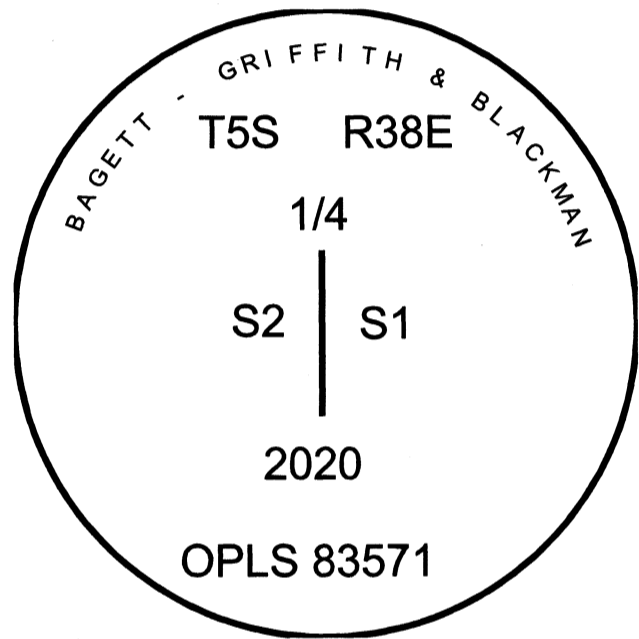

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
June 2, 2010
JEFFREY S. HSU
83571

Renewal Date: June 30, 2021

UNION COUNTY
SURVEYOR

Date Received 10/12/2020

Date Filed 10/12/2020

Filed By JHS

File Number 062-2020R

I used a steel tape and magnetic compass in the establishment of the new accessories. I used 14° East declination, the distances are to a 60d spike driven into the right side of the root crown of the bearing trees. A brass washer marked OPLS 83571 is attached to the BT blaze of the new bearing trees.