### CERTIFIED RECORD OF LAND CORNER MONUMENTATION

## HISTORY OF ORIGINAL CORNER ESTABLISHED:

Corner originally established by W. B. Barr under  ${\tt GLO}$ contract number 388 dated May 7, 1881. Surveyor General field notes state:

Marked volcanic rock 12x10x10 for 1/4 sec. corner, from which:

A Pine 36 in. diam bears N55°W 42 lks dist

A Pine 40 in. diam bears S70°E 67 lks dist

T5S R38 E E-15 10 S

## DESCRIPTION OF CORNER EVIDENCE FOUND:

Found a 12x10x10 volcanic stone, set 4" in the ground, with chiseled 1/4 in North face. No remains found of the original bearing trees.

SEE SURVEY 035-2020

# DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO MONUMENT THE ORIGINAL LOCATION OF THIS CORNER:

At the position of the found stone I set a 2 1/2" x 30" aluminum pipe, 26" in the ground, with 3" aluminum cap marked as shown below and in a 2' diam. mound of stone, From which:

#### **NEW BEARING OBJECTS:**

A 7" Douglas Fir bears North 50° East a dist. of

45.60 ft., marked 1/4 S3 BT.
An 8" Douglas Fir bears South 78° East a dist. of 57.20 ft., marked 1/4 S10 BT.

A 14" Douglas Fir bears South 39° West a dist. of 33.65 ft., marked 1/4 S10 BT.

A 7" Ponderosa Pine bears North 38° West a dist. of 56.50 ft., marked 1/4 S3 BT.


### A steel fence post is approx.1' East of the aluminum cap.

I hereby certify that the corner was perpetuated on September 2, 2020.

Witness: Kyle A. Tucker

GRI FFI TH T5S R38E S31/4 S10 2020 **OPLS 83571** 

I used a steel tape and magnetic compass in the establishment of the new accessories. I used 14° East declination, the distances are to a 60d spike driven into the right side of the root crown of the bearing A brass washer marked OPLS trees. 83571 is attached to the BT blaze of the new bearing trees.

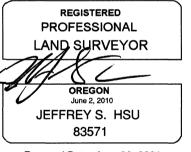

Renewal Date: June 30, 2021

