


**CERTIFIED RECORD OF LAND CORNER MONUMENTATION**

**HISTORY OF ORIGINAL CORNER ESTABLISHED:**

Corner not previously established.

T 5 S R 38 E E-16

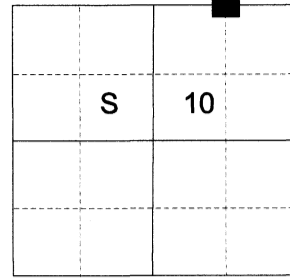

**DESCRIPTION OF CORNER EVIDENCE FOUND:**

None.

SEE SURVEY 035-2020

**DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO MONUMENT THE ORIGINAL LOCATION OF THIS CORNER:**

At position by survey I set a 5/8" x 30" iron pin, 27" in the ground, with 2 1/2" aluminum cap marked as shown below and in a 2' diam. mound of stone,  
From which:


**NEW BEARING OBJECTS:**

A 5" Ponderosa Pine bears North 40° East a dist. of 11.80 ft., marked E 1/16 S3 BT.  
A 6" Ponderosa Pine bears South 29° West a dist. of 8.80 ft., marked E 1/16 S10 BT.

Set steel fence post approx. 1 ft. North.

Monument falls approx. 125 ft. West of North/South bearing forest road.

I hereby certify that the corner was monumented on September 28, 2020.  
Witness: Kyle A. Tucker

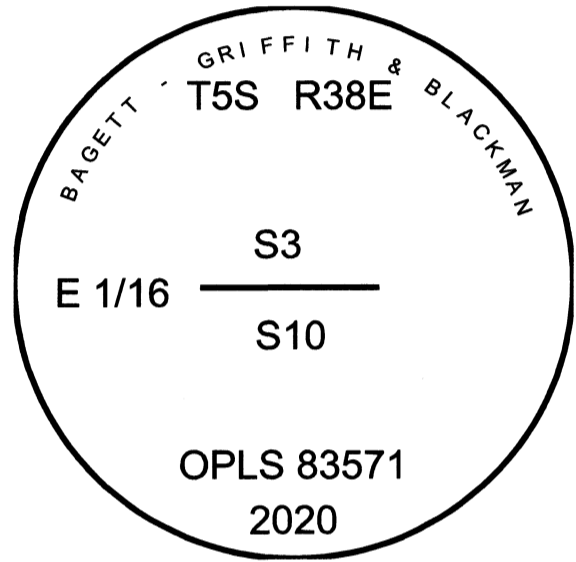

Renewal Date: June 30, 2021

I used a steel tape and magnetic compass in the establishment of the new accessories. I used 14° East declination, the distances are to a 60d spike driven into the right side of the root crown of the bearing trees. A brass washer marked OPLS 83571 is attached to the BT blaze of the new bearing trees.

