


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHED:

Corner not previously established.

T 5 S R 38 E H-22

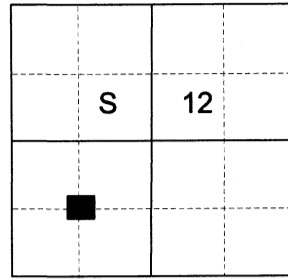

DESCRIPTION OF CORNER EVIDENCE FOUND:

None found.

SEE SURVEY 046-2021

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

At position by Survey I set a 5/8" x 30" iron pin, 32" in the ground, with 2 1/2" aluminum cap marked as shown below, from which:


NEW BEARING OBJECTS:

A 14" Western Larch bears North 31° East, a dist. of 15.80 ft., marked SW 1/16 S12 BT
A 12" Western Larch bears North 90° West, a dist. of 19.30 ft., marked SW 1/16 S12 BT

Set steel fence post approx. 0.5 ft. West
Falls on S. edge of NW running forest road.

I hereby certify that the corner was monumented on
October 12, 2021.

Witnesses: Kyle Tucker, Emmitt Ambert

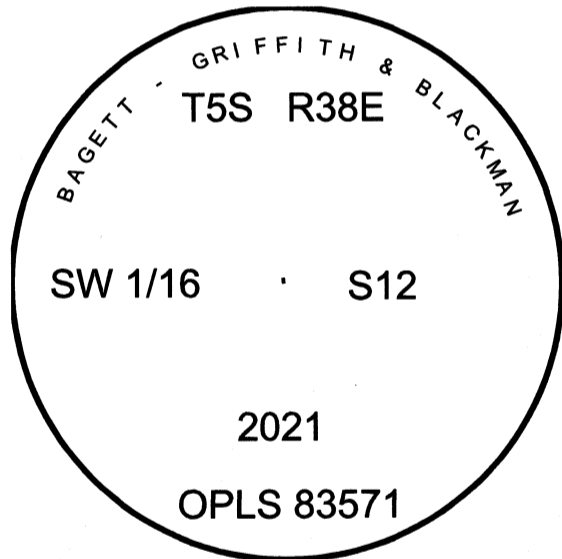

UNION COUNTY SURVEYOR

Date Received 11/1/21

Date Filed 11/1/21

Filed By Madeline DEATY

File Number 055-2021R

I used a steel tape and magnetic compass in the establishment of the new accessories. I used 14° East declination. Distances are to a 60d spike driven into the right side of the root crown of the bearing trees. Bearings are to a brass washer marked OPLS 83571 in the BT blaze of the new bearing trees.