UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

RG23 ORIGINAL

23

## FIELD NOTES

OF THE	
REPONUMENTATION OF CERTAIN ORIGINAL CORNER POINT	1,
TOWNSHIP 5 SOUTH, RANGE 38 EAST,	
WILLAMETTE	A
Of the	Moridian,
the State of	
EXECUTED BY	
Scott R. McIntyre, Cadastral Surveyor	
	-
Under special instructions dated July 13 , 19 79 , approved	July 17, 1979
, which provided for the surveys included	under II.S. Survey/Grown
Number 1000 , and annignment instructions dated July 30	
100 to 10	to the second se
Survey commenced August 20 , 19 82	UNION COUNTY
Survey completed August 31 , 19 82	SURVEYOR
	Date Received 2-2-84
	Date Filed 2-28-84
	By G. LANGLITZ DEP
	File No. 815-84 R

Page 1/3

Remonumentation of Certain Original Corner Points, T. 5 S., R. 38 E., Willamette Meridian, Oregon

At the corner point

Set an aluminum post, 28 ins. long,  $2^{i}_{2}$  ins. diam., 23 ins. in the ground, with aluminum cap mkd.

T 5 8 R 38 E k 8 15 8 22 1982

from which new bearing trees

A ponderosa pine, 5 ins. diam., bears 9. 3° E., 56½ lks. dist., mkd. k S22 BT.

A fir, 8 ins. dism., bears M. 22° M., 33 lks. dist., mkd. k S15 BT.

Deposit corner stone and set a steel fence post alongside aluminum post.

The k sec. cor. of secs. 10 and 15, monumented with the original baselt stone, 12 x 8 x 6 ins., firmly set 4 ins. in the ground, no marks visible, from which the remains of an original bearing tree:

A root hole, bears S. 48° W., S lks. dist., with a decayed larch alongside, size indeterminate, with illegible scribe marks wisible.

At the corner point

Set an aluminum post, 28 ins. long, 24 ins. diem., 22 ins. in the ground, with aluminum cap mkd,

T 5 S R 38 E k 8 10 8 15 1982

from which new bearing trees

- A fir, 23 ins. diam., bears N. 17° E., 25 lks. dist., mkd. k S10 BT.
- A larch, 8 ins. diam., bears S. 30° E., 14 lks. dist., mnd. k S15 BT.

Deposit corner stone and set a steel fence post alongside aluminum post.

NION COUNTY SURVEYOR

Data Received 2-2-84

Date Filed 2:28-84

BY G. LANGLITZ DEPU

File No. 815 - 84 R

Pace 2/3

The cor. of secs. 28, 29, 32, and 33, determined from the remains of the original bearing trees:

- A larch, 25 ins. diam., bears S. 50° W., 26 lks. dist., with scribe marks 8 32 visible on open blaze. (Record, S. 55° W.)
- A sawed pine stump, 45 ins. diam., bears N. 36° W., 67 lks. dist., no marks visible. (Record, N. 40° W.)

At the corner point

Set as aluminum post, 28 ins. long,  $2^{i_2}$  ins. diam., 15 ins. in the ground, to solid rock, in a mound of stone,  $3^{i_3}$  st. base, to top, with aluminum cap mkd.

Remonumentation of Certain Original Corner Points, T. 5 S., R. 38 E., Willamette Meridian, Oregon

### UNION COUNTY SURVEYOR

Date Received 2-2-84

Date Filed 2-28-84

BY G. LANGLITZ DEPUTY File No. 815-84 R

PAGE 3/3

T 5 S R 38 E S 29 S 28 S 32 S 33 1982

from which new bearing trees

- A fir, 11 ins. diam., bears N. 88° E., 1321 lks. dist., mkd. T5S R38E S28 BT.
- A fir, 10 ins. diam., bears S. 44° E., 85 lks. dist., mkd. T5S R38E 833 BT.
- A larch, 13 ins. diam., bears N. 18° W., 69 lks. dist., mkd. T5S R38E S29 BT.

Set a steel fence post alongside aluminum post.

Corner is located on W. edge of logging road, 20 lks. wide, bears N. and S.

The  $\frac{1}{3}$  sec. cor. of secs. 28 and 33, determined at record bearing and distance from the remains of the original bearing trees:

- A pine snag, 36 ins. diam., bears S. 20° E., 18 lks. dist., with scribe marks k S BT visible on open blaze.
- A sawed pine stump, 36 ins. diam., bears N. 75° W., 57 lks. dist., no marks visible.

At the corner point

Set an aluminum post, 28 ins. long,  $2\frac{1}{2}$  ins. diam., 21 ins. in the ground, in a collar of stone, with aluminum cap mkd.

from which new bearing trees

- A ponderosa pine, 13 ins. diam., bears S. 24° E., 37 lks. dist., mkd. k S33 BT.
- A fir, 28 ins. diam., bears N. 66° W., 31½ lks. dist., mkd. ½ S28 BT.

Corner is located in a fence line, extending W. and S.

The  $\frac{1}{8}$  sec. cor. of secs. 28 and 29, monumented with the original basalt stone,  $16 \times 12 \times 4$  ins., firmly set 10 ins. in the ground, no marks visible, from which the remains of the original bearing trees:

- A ponderosa pine, 21 ins. diam., bears N. 89° E., 158 lks. dist., with healed blaze. (Record, 165 lks.)
- A saved pine stump, 40 ins. diam., bears S. 104° W., 244 lks. dist., no marks visible.

## CERTIFIED RECORD OF LAND CORNER MONUMENTATION

#### History of original corner establishment:

Original corner set by William B. Barr, under GLO Contract No. 388, approved December 31, 1881

Record States: Set Stake 4 ft long 4 in diam. 18 in ground for corner to sec 28, 29, 32, 33, from which:

Tamarack, 18 inch in diam., bears S 55° W, 26 lks dist.

Tamarack, 20 inch in diam., bears S 37° E, 22 lks dist.

Pine, 3 inch in diam., bears N 60° E, 3 lks dist.

Pine, 40 inch in diam., bears N 40° W, 67 lks dist.

#### Subsequent Monumentation

Corner was remonumented by Scott R. McIntyre, under BLM Group No. 1000, approved December 27, 1983

Record States: The cor. of secs. 28, 29, 32, and 33, determined from the remains of the original bearing trees:


A larch, 25 ins. diam., bears S. 50° W., 26 lks. dist., with scribe marks 8 32 visible on open blaze. (Record, S. 55° W.)

A sawed pine stump, 45 ins. diam., bears N. 36° W., 67 lks. dist., no marks visible. (Record, N. 40° W.)

At the corner point: Set an aluminum post 28 ins. long, 2 ½ ins. diam., 15 ins. in the ground, to solid rock, in a mound of stone, 3 1/2 st. [sic] base, to top, with aluminum cap mkd. (as shown below), from which new bearing trees:

A fir, 11 ins. diam., bears N. 88° E., 132 ½ lks. dist., mkd. T5S R38E S28 BT.

A fir, 10 ins. diam., bears S. 44° E., 85 lks. dist., mkd. T5S R38E S33 BT. A larch, 13 ins. diam., bears N. 18° W., 69 lks. dist., mkd. T5S R38E S29 BT.

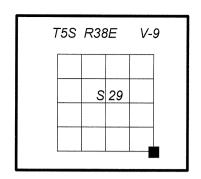

#### Description of corner evidence found:

Found 21/2 ins. diam. alum. pipe, projecting 10 ins. above ground, with 3 ft diam. stone mound to top, with a standard BLM 31/4 ins. diam. alum. cap, marked as shown:

From the recovered monument I find the original bearing trees:

A larch, 25 ins. diam., bears S. 50° W., 26 lks. dist., alive and healthy, with "S32" visible in open upper blaze, tree has wire around, part of old fence

A sawed pine stump, 45 ins. diam., bears N. 36° W., 67 lks. dist., burnt on outside, no scribing visible. And accessories mkd. by McIntyre:

A white fir, 14 ins. diam., bears N. 88° E., 1321/2 lks. dist., alive with a dead top and "5S R38E S28 BT" visible on an open blaze.

A root hole, bears S. 44° E., 85 lks. dist., with a fir 10 ins. diam. alongside, laying on blaze.

A larch, 17 ins. diam., bears N. 18° W., 69 lks. dist., alive and healthy, with healed single blaze.

Found guard post ±2.5 ft.E'ly.

### THE T5S R38E S29 S28 S32 S33 1982 LAND MANAG

#### Description of monument and accessories I established to perpetuate original location of this corner:

New bearing tree:

A larch, 10 ins. diam., bears S. 421/2° E., 63.7 ft. dist., mkd. T5S R38E S33 BT

New bearing tree marked on a single blaze and has a nail with a brass washer stamped "LS 2648" right side center for distance measurements

Painted 6 ins. red bands and added Bearing Tree (54-3) and Land Survey Monument (54-9) signs as needed to all bearing trees.

Auto C/A geographic position: 45°05'38.0" N Long. 118°04'34.5" W

I hereby certify that the corner is monumented and accessories taken as described. using a Warren Knight staff compass, set with 15° East declination, and steel tape on June 14, 2014.

Witnesses: Kristina Powell and Brenda Johnson

REGISTERED **PROFESSIONAL** LAND SURVEYOR

# Deceased

OREGON JANUARY 18, 1994 RON C. WALTER 2648

Renewal Date: June 30, 2016

REGISTERED **PROFESSIONAL** LAND SURVEYOR

Willi R. Wells **OREGON** July 22, 1977 WILLIAM R. WELLS 1106

Renewal Date: June 30, 2016

UNION COUNTY SURVEYOR	
Date Received 2 25/15	
Date Filed 2/75/15	
By MG Men	
File No. 037-701512	

NOTE: See "Explanation for Successor Certifying Surveyor" statement in Narrative of Record of Survey , CS 010-2015, filed concurrently with this Land Corner Record.