
CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

None

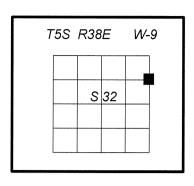

Description of corner evidence found:

None

Description of monument and accessories I established to perpetuate original location of this corner:

At the position determined by survey, I set a standard USFS 2% ins. diam. by 30 ins. long alum. pipe, 24 ins. in ground, with 3% ins. diam. alum. cap, and rock collar, with clear DEEP-1 magnet at base, mkd as shown:

From which:

A tamarack, 6 ins. diam., bears N. 29° E., 45.0 ft. dist., mkd. XBT. A tamarack, 12 ins. diam., bears S. 44° E., 28.4 ft. dist., mkd. N1/16 S33 BT.

Set guard posts ±5 ft. N'ly with Property Boundary (54-2) sign and ±5 ft. W'ly with Property Boundary (54-2) and Land Survey Monument (54-9) signs attached.

All new bearing trees are marked on a single blaze and have a nail with a brass washer stamped "LS 2648" right side center for distance measurements.

Painted 6 ins. red bands and added Bearing Tree (54-3) and Land Survey Monument (54-9) signs as needed to all bearing trees.

Auto C/A geographic position: Lat. 45°05'24.2" N

Lat. 45°05'24.2" N Long. 118°04'34.3" W

I hereby certify that the corner was monumented and accessories taken as described, using a Warren Knight staff compass, set with 15° East declination, and steel tape on August 15, 2014.

Witnesses: Kristina Powell, Brenda Johnson and Justin Seal



REGISTERED PROFESSIONAL LAND SURVEYOR

Deceased

OREGON
JANUARY 18, 1994
RON C. WALTER
2648

Renewal Date: June 30, 2016

REGISTERED PROFESSIONAL LAND SURVEYOR

OREGON
July 22, 1977
WILLIAM R. WELLS

1106 Renewal Date: June 30, 2016

UNION COUNTY
SURVEYOR

Date Received 7 25 15

Date Filed 2 25 15

By J.C. Men.

File No. 040-2015 R

NOTE: See "Explanation for Successor Certifying Surveyor" statement in Narrative of Record of Survey , CS 010-2015, filed concurrently with this Land Corner Record.