

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Original corner set by Timothy W. Davenport, under GLO Contract No. 102, approved January 12, 1864.

Record States: Set 1/4 sec post in N side of bottom, from which:


- A spruce 16 ins dia bears N85°W 38 lks dist
- A spruce 10 ins in dia bears N35°E 26 lks dist

Subsequent Monumentation

Corner was rehabilitated by William B. Barr, under GLO Contract No. 388, approved December 31, 1881.

Record States: Corner agreeing with description. Post. From which:

- Spruce 16 in diam bears N85°W 38 lks dist
- Spruce 10 in diam bears N35°E 26 lks dist

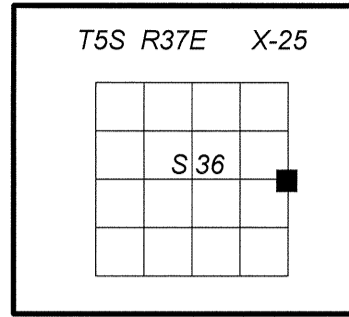

Description of corner evidence found:

Thorough search of area finds no evidence of original corner. Search area has been logged extensively. Corner is determined lost and reestablished by proportionate measurement.

Description of monument and accessories I established to perpetuate original location of this corner:

At the position determined by survey, I set a standard USFS 2 1/2 ins. diam. by 30 ins. long alum. post, 24 ins. in the ground with 3/4 ins. diam. alum cap, with rock collar, and clear DEEP-1 magnet at base, marked as shown:

From which:

- An Englemann spruce, 12 ins. diam., bears N. 64° E., 15.1 ft. dist., mkd. 1/4 S31 BT.
- A lodgepole pine, 6 ins. diam., bears S. 21 1/4° E., 10.4 ft. dist., mkd. X BT on double blaze.
- An Englemann spruce, 24 ins. diam., bears S. 22 1/4° W., 37.7 ft. dist., mkd. 1/4 S36 BT.
- A lodgepole pine, 7 ins. diam., bears N. 39 3/4° W., 16.8 ft. dist., mkd. 1/4 S36 BT.

Set guard posts ±6 ft N'ly with Property Boundary (54-2) and Land Survey Monument (54-9) signs, and ±6 ft. E'ly with a Property Boundary (54-2) sign.

All new bearing trees are marked on a single blaze unless noted otherwise and have a nail with a brass washer stamped "LS 2648" right side center for distance measurements.


Painted 6 ins. red bands and added Bearing Tree (54-3) and Land Survey Monument (54-9) signs as needed to all bearing trees.

Auto C/A geographic position:

- Lat. 45°05'10.3" N
- Long. 118°06'58.9" W

I hereby certify that the corner was monumented and accessories taken as described, using a Warren Knight staff compass, set with 15° East declination, and steel tape on September 13, 2014.

Witnesses: Brenda Johnson and Justin Seal

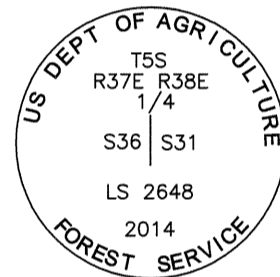

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Deceased

OREGON
JANUARY 18, 1994
RON C. WALTER
2648

Renewal Date: June 30, 2016

REGISTERED
PROFESSIONAL
LAND SURVEYOR

William R. Wells

OREGON
July 22, 1977
WILLIAM R. WELLS
1106

Renewal Date: June 30, 2016

**UNION COUNTY
SURVEYOR**

Date Received 2/25/15

Date Filed 2/25/15

By *Paul G. Miller*

File No. 98-2015R

NOTE: See "Explanation for Successor Certifying Surveyor" statement in Narrative of Record of Survey, CS 010-2015, filed concurrently with this Land Corner Record.