


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Original corner set by William B. Barr, under GLO Contract No. 388, approved December 31, 1881.
 Record States: Marked Tamarack 12 in. diam for ¼ sec corner, from which:
 Tamarack, 12 inch in dia., bears N 60° W, 19 lks dist.
 Tamarack, 15 inch in dia., bears S 86° E, 29 lks dist.

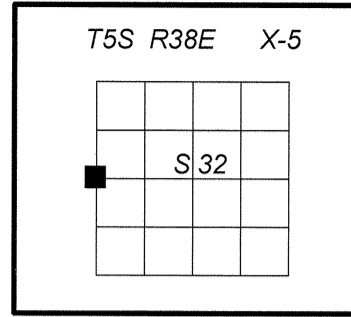

Description of corner evidence found:

Found corner tree remains supporting proportionate corner position. Scribe marks "1/4 S" visible on tree remains, with blank Bearing Tree (54-3) and Attention (54-4) signs attached and a 54-5 marked "Direction XX Bearing XX E 1/4 Date 70". Multiple trees in area with Location (54-5) signs attached. Used distance distance intersection from location signs to set corner in depression, found old flagging while excavating. Found a root hole at approximate bearing and distance for SE tree, bearing tree remains were not found.

Description of monument and accessories I established to perpetuate original location of this corner:

At the above described point, I set a standard USFS 2½ ins. diam. by 30 ins. long alum. pipe, 26 ins. in ground, with ¾ ins. diam. alum. cap, and rock collar, with clear DEEP-1 magnet at base, mkd. as shown:

New bearing trees:

- A tamarack, 14 ins. diam., bears N. 76° E., 78.4 ft. dist., mkd. 1/4 S32 BT.
- An Engelmann spruce, 8 ins. diam., bears S. 88 ° E., 17.8 ft. dist., mkd. 1/4 S32 BT.
- A lodgepole pine, 7 ins. diam., bears S. 17 ° W., 8.9 ft. dist., mkd. XBT.
- An Engelmann spruce, 13 ins. diam., bears N. 30° W., 68.1 ft. dist., mkd. 1/4 S31 BT.

Set guard post ±4 ft. N'ly with Land Survey Monument (54-9) sign attached.

All new bearing trees are marked on a single blaze unless noted otherwise and have a nail with a brass washer stamped "LS 2648" right side center for distance measurements.


Painted 6 ins. red bands and added Bearing Tree (54-3) and Land Survey Monument (54-9) signs as needed to all bearing trees.

Auto C/A geographic position:

Lat. 45°05'09.9 N
 Long. 118°05'46.0" W

I hereby certify that the corner was monumented and accessories taken as described, using a Warren Knight staff compass, set with 15° East declination, and steel tape on August 12, 2014.

Witnesses: Kristina Powell, Brenda Johnson and Justin Seal

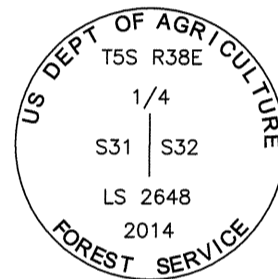

REGISTERED
 PROFESSIONAL
 LAND SURVEYOR

Deceased

OREGON
 JANUARY 18, 1994
 RON C. WALTER
 2648

Renewal Date: June 30, 2016

REGISTERED
 PROFESSIONAL
 LAND SURVEYOR

Willi R. Wells

OREGON
 July 22, 1977
 WILLIAM R. WELLS
 1106

Renewal Date: June 30, 2016

**UNION COUNTY
 SURVEYOR**

Date Received 2/25/15

Date Filed 2/25/15

By *W. G. Miller*

File No. 042-2015R

NOTE: See "Explanation for Successor Certifying Surveyor" statement in Narrative of Record of Survey, CS 010-2015, filed concurrently with this Land Corner Record.