CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Index File No. Z-3

History of original corner establishment:

Corner was originally established by T. Davenport, under G.L.O. contract No. 102, in September, 1863. Surveyors General's notes state: "Set up Sec. post on top of ridge from which a Pine 20 inch in dia. bears S35°E, 22 lks. dist. a Red Fir 20 inch in dia. bears N85°E, 30 lks. dist."

DIAGRAM T5SR38E 1/4 | S31 T6SR38E

T5SR38E

Description of corner evidence found:

Found 30" pine with 54-3 and scribed 1/4. No traced of post or other BT. Measured N35°W, 16.5 ft.

Description of monument and accessories I established to perpetuate the original location of this corner:

At center of above described point set 2 1/2" 1/4 | S31 x 30" galvanized pipe and brass cap marked: Set pipe 24" in the ground and mound of stone T6SR38E around to cap. OR PLS 1051 From which, by magnetic declination of N20°E: 1979 A 10" fir bears NO6°W, 24.3 ft. scribed 1/4 S31 BT. Placed 54-3 and brass washers stamped PLS 1051 on BTs. Placed 54-4 on tree 20' NE. Painted blaze red and 6" red band around. Placed 54-2 and 54-4 on steel fence post 5' East and 54-2 on steel fence post 5' North of corner.

REGISTERED **PROFESSIONAL** LAND SURVEYOR

Jana OREGON OCT. 17. 1975 BARRY B. BARBOUR

COUNTY DEFICIALL

I hereby certify that the above corner monument was reestablished as herein described.

Witnesses:

David L. Landers Robert S. Stevens

July 19, 1979

Office of County Surveyor County of Union	
State of Oregon , I hereby certify that the within instrument was	filed in this office
for record on the 6.th. day of December 19.7.9	T
wall by a Liller	Į (
(COUNTY DESICIAL)	

Form R6-7100-57 (9/71)

UNION COMMITTY SURVEYOR

Date Filed

File No. 709-84R

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Original corner set by Timothy W. Davenport, under GLO Contract No. 102, approved January 12, 1864.

Record States: Set 1/4 Sec. post on top of ridge from which:

A Pine, 20 inch in dia., bears S 35° E, 22 lks dist.

A Red Fir, 20 inch in dia., bears N 85° E, 30 lks dist.

Subsequent Monumentation

Corner was rehabilitated by William B. Barr, under GLO Contract No. 388, approved December 31, 1881.

Record States: Corner agreeing with description Post from which: Pine 20 in. diam. bears S35°E 25 lks dist

Fir 20 in diam bears N85°E 35 lks dist.


Corner was remonumented by Barry B. Barbour, LS 1051, as described by File No. 709-84R, filed December 6, 1979, in the records of the Union County Surveyor.

Record states: Found 30" pine with Bearing Tree (54-3) sign and scribed 1/4. No traced [sic] of post or other BT. Measured N35°W, 16.5 ft.

At center of above described point set 2½ " x 30" galvanized pipe and brass cap marked (as shown below): Set pipe 24" in the ground and mound of stone around to cap.

From which by magnetic declination of N20°E:

A 10" fir bears N06°W, 24.3 ft. scribed 1/4 S31 BT.

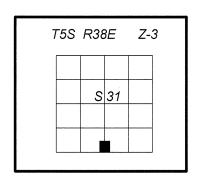

Description of corner evidence found:

Found 2½ ins. diam. iron pipe, projecting 6 ins. above ground, with rock collar, and 2½ ins. diam. brass cap, marked as shown:

From the recovered monument I find the original bearing tree remains:

A pine stump, 31 ins. diam., bears S. 35° E., 16.5 ft. dist. to face, with 1/4 visible on open blaze. And accessories mkd. by Barbour:

A fir snag, 10 ins. diam., bears N. 6° W., 24.3 ft. dist., with 1/4 S31 BT visible on open double blaze.

Found guard posts ±5 ft. N'ly and E'ly.

T5S R38E 1/4 S31 T6S R38E ORPLS 1051 1979

Description of monument and accessories I established to perpetuate original location of this corner:

New accessories:

A ponderosa pine, 13 ins. diam., bears N. 441/4° E., 91.2 ft. dist., mkd. 1/4 S31 BT.

A Silver DEEP-1 magnet, buried 12 ins. deep, bears N. 47%° E., 7.7 ft. dist. A ponderosa pine, 12 ins. diam., bears N. 37° W., 68.5 ft. dist., mkd. 1/4 S31 BT.

A Pink DEEP-1 magnet, buried 12 ins. deep, bears N. 571/2° W., 6.4 ft. dist.

All new bearing trees are marked on a single blaze and have a nail with a brass washer stamped "LS 2648" right side center for distance measurements.

Painted 6 ins. red bands and added Bearing Tree (54-3) and Land Survey Monument (54-9) signs as needed to all bearing trees

Auto C/A geographic position: Lat. 45°04'43.9" N

Long. 118°06'22.1" W

I hereby certify that the corner is monumented and accessories taken as described, using a Warren Knight staff compass, set with 15° East declination, and steel tape on June 19, 2014.

Witnesses: Ron Walter and Kristina Powell

REGISTERED **PROFESSIONAL** LAND SURVEYOR

Deceased

OREGON JANUARY 18, 1994 RON C. WALTER 2648

Renewal Date: June 30, 2016

REGISTERED PROFESSIONAL LAND SURVEYOR

elli R. Well OREGON July 22, 1977 WILLIAM R. WELLS

1106 Renewal Date: June 30, 2016

UNION COUNTY SURVEYOR	
Date Received 2 25 15	
Date Filed 2 25 15	
By AlGHair	
File No. <u>048-2015</u> R	

NOTE: See "Explanation for Successor Certifying Surveyor" statement in Narrative of Record of Survey, CS 010-2015, filed concurrently with this Land Corner Record.