


**CERTIFIED RECORD OF LAND CORNER MONUMENTATION**

**HISTORY OF ORIGINAL CORNER ESTABLISHED:**

Corner not previously established.

T 5 S R 40 E E-22

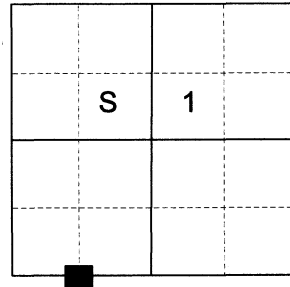

**DESCRIPTION OF CORNER EVIDENCE FOUND:**

From a position determined by survey, a mound of stone, 2 ft. diam. falls West approx. 2 ft.

See Surv. no. 050-2021

**DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO MONUMENT THE ORIGINAL LOCATION OF THIS CORNER:**

At position by Survey I set a 5/8" x 30" iron pin, 28" in the ground, with 2 1/2" aluminum cap marked as shown below, with 2' diam. collar of stone, from which:

**NEW BEARING OBJECTS:**

A 5/8"x 30" iron pin with 1 1/2" aluminum cap bears South 25° 58' East, a dist. of 9.46 ft., marked SE RP

A 5/8"x 30" iron pin with a 1 1/2" aluminum cap bears North 44° 08' West, a dist. of 16.53 ft., marked NW RP

Set steel fence post approx. 1 ft. South

I hereby certify that the corner was monumented on October 22, 2021.


Witnesses: Kyle Tucker, Emmitt Ambert

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR



OREGON  
June 2, 2010  
JEFFREY S. HSU  
83571

Renewal Date: June 30, 2023

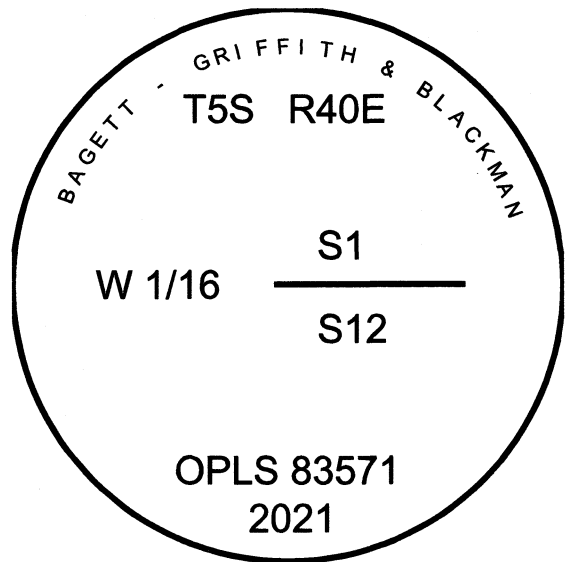

**UNION COUNTY  
SURVEYOR**

Date Received 11/15/21

Date Filed 11/15/21

Filed By Neil G. [Signature]

File Number 040-2021R

I used a Leica GS18 RTK GPS rover in the establishment of the new accessories. Basis of Bearing is as per Survey Number 050-2021. I use 14° East magnetic declination. The distances and bearings are to the center of the aluminum caps.