

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

INDEX NO. O.5-18

History of original corner establishment:

None. Corner established this survey.

DIAGRAM
T5S R41E
C-S-NW 1/64
S23
1994

Description of Corner Evidence Found:

None. Corner established this survey.

Description of monument and accessories I established to perpetuate the original location of this corner:

Set 2" O.D. x 30" ~~galvanized iron~~ ^{ALUMINUM} pipe 26" in ground with 2" aluminum cap with magnet and flared ends, stamped as shown on the DIAGRAM, in a mound of stone.


From Which:

- A Ponderosa Pine, 24" dia., bears N05°25'E, 35.9 ft., scribed: CSNW 1/64 S23 BT
- A Douglas Fir, 18" dia., bears S02°30'W, 9.3 ft., scribed: CSNW 1/64 S23 BT

Measurements to BT's taken with magnetic compass, with the declination set at 20°E and chain. Nailed Bearing Tree (54-3) signs above blaze and Land Survey Monument (54-9) signs on back of each tree as required. Painted a 6" red band above Bearing Trees signs. Set 1/2" brass disc at base of blaze stamped: "L. MILLER PLS 2513". Set steel fence post with Land Survey Monument (54-9) and Property Boundary (54-2) signs alongside monument. Set steel fence post with 54-2 sign West 50' and East 50' from monument.

This monumentation was performed by:
Linda Lee Miller, PLS 2513
Witnessed by:
Russell Avery, PE, PLS
August 23, 1994

Sketch

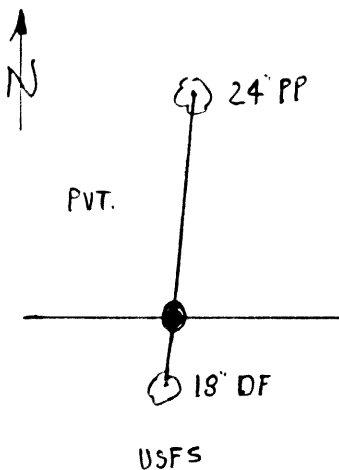


Monument Detail



Location/Comments

Mean Magnetic Declination 20° East

SURVEYOR

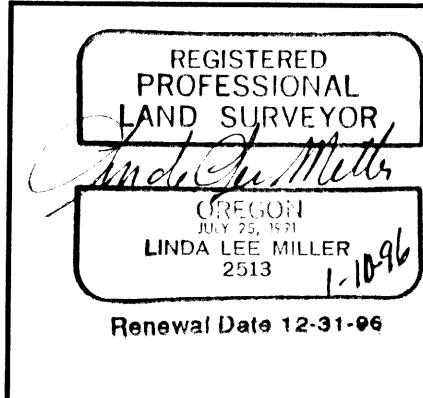

UNION COUNTY

UNION COUNTY REGISTERED	
Date Received	2-2-96
Date Filed	2-5-96
By	R. ROBINSON, DEPUTY
File No.	012-1996R