

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

A-15

83

*already have  
just file  
AM*

FIELD NOTES

OF THE

REMONUMENTATION OF CERTAIN ORIGINAL CORNER POINTS,

TOWNSHIP 4 SOUTH, RANGE 41 EAST,

Lined area for field notes.

Of the WILLAMETTE Meridian,

In the State of OREGON

EXECUTED BY

Stephen D. Albright, Cadastral Surveyor

Lined area for signature and date.

Under special instructions dated May 3, 19 57, which provided for the surveys  
included under Group Number 350, approved May 6, 1957,  
and assignment instructions dated September 20, 19 71.

Survey commenced October 4, 19 71

Survey completed October 4, 19 71

## T. 4 S., R. 41 E., Willamette Meridian, Oregon

CHAINS

The following field notes describe the remonumentation of certain original corner points, township 4 south, range 41 east, Willamette Meridian, Oregon, as provided for in the General Special Instructions, Group Number 350 Oregon, dated May 3, 1957, "Investigation of Collateral or Physical Evidence of Corner Positions and Accessories, Followed by Remonumentation of Corner Points, with New Accessories when Needed".

The remonumentation of original corner points was made at the request of the United States Forest Service, in conjunction with their Land Line Location Program.

The mean magnetic declination is 20° E.

South Boundary, T. 4 S., R. 41 E.,  
Willamette Meridian, Oregon

(Remonumenting a corner established by Henry M. Thatcher,  
Deputy Surveyor, in 1879)

The  $\frac{1}{4}$  sec. cor. of secs. 3 and 34, on the S. bdy. of the Tp., determined at record bearing and distance from the only remaining original bearing tree:

A fir snag, 34 ins. diam., bears N. 25° W., 20 lks. dist., with scribe marks BT visible on open blaze.

At the corner point

Set an iron post, 28 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.

T 4 S R 41 E

$\frac{1}{4}$  S 34

S 3

T 5 S

1971

from which new bearing trees

A fir, 12 ins. diam., bears N. 2° W., 50 lks. dist., mkd.  $\frac{1}{4}$  S34 BT.

A white fir, 12 ins. diam., bears S. 84½° W., 74 lks. dist., mkd.  $\frac{1}{4}$  S3 BT.

Set 5 ft. steel fence post alongside iron post.

~~Subdivision, T. 4 S., R. 41 E.,  
Willamette Meridian, Oregon~~

~~(Remonumenting corners established by Henry M. Thatcher,  
Deputy Surveyor, in 1879)~~

~~The cor. of secs. 27, 28, 33, and 34, determined at record bearing and distance from the remains of the original bearing trees:~~

~~A root hole, bears N. 50° E., 28 lks. dist.~~

UNION COUNTY  
SURVEYOR

Date Received 9-12-83

Date Filed 9-12-83

By G. LANGLITZ DEPUTY

File No. 341-83 R

~~UNION COUNTY  
SURVEYOR~~

~~Date Received 9-12-83~~

~~Date Filed 9-12-83~~

~~By G. LANGLITZ DEPUTY~~

~~File No. 342-83 R~~

494

Subdivision of Section 3,  
T. 5 S., R. 41 E., Willamette Meridian, Oregon

CHAINS

74.575

The ¼ sec. cor. of secs. 3 and 34 on the N. bdy. of the Tp.,  
monumented with an iron post, 2½ ins. diam., firmly set,  
projecting 8 ins. above ground, with brass cap mkd.

T 4 S  
S 34  
¼ ——— R 41 E  
S 3  
T 5 S  
1971

from which the remains of the original bearing trees

A root hole, bears S. 25° W., 25 lks. dist.

The rotted remains of a fir stump, bears N. 25° W.,  
20 lks. dist., with fragmentary scribe marks on  
loose wood alongside.

and the remains of bearing trees mkd. by Albright

A fir snag, 14 ins. diam., bears S. 82° W., 74 lks.  
dist., with fragmentary scribe marks on partially  
healed blaze. (Record, S. 84½° W.)

A fir, 18 ins. diam., bears N. 4° W., 50 lks. dist.,  
with healed blaze. (Record, N. 2° W.)

and a new bearing tree

A lodgepole pine, 10 ins. diam., bears S. 55½° E.,  
24 lks. dist., mkd. ¼ S3 BT.

From the ¼ sec. cor. of secs. 2 and 3.

S. 87° 08' 30" W., on the E. and W. center line of sec. 3.

Ascend E. slope.

13.50

Ridge, bears N. and S.; desc. W. slope to creek, cross creek and  
asc. E. slope.

40.935

The center ¼ sec. cor. of sec. 3.

Descend over broken W. slope, through logged area.

79.50

Graveled road, 25 lks. wide, bears N. 20° E. and S. 20° W.

81.660

The ¼ sec. cor. of secs. 3 and 4.

From the center N 1/16 sec. cor. of sec. 3.

S. 87° 45' 00" W., on the E. and W. center line of the NW¼ of sec.  
3.

Descend SW. slope, through medium timber and light undergrowth.

Creek, 15 lks. wide, course NW.; asc. NE. slope.

UNION COUNTY  
SURVEYOR

Date Received

3/5/13

Date Filed

3/5/13

By

Rich G. Adams

File No.


023-2013R

**CERTIFIED RECORD OF LAND CORNER MONUMENTATION**

**HISTORY OF ORIGINAL CORNER ESTABLISHED:**

Corner established by H.M. Thatcher under contract no. 320, dated April 1, 1879. Surveyor General field notes state: Set Fir Post 4 ft. long 4 in. in dia. bor 1/4 Sec. Cor. from which:  
 A fir 30 in. in dia. bears N25°W, 20 lks. dist.  
 A fir 12 in. in dia. bears S25°W. 25 lks. dist.

T 4 S R 41 E Z-15

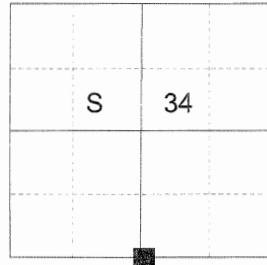

Corner brought to BLM standard by Stephen Albright in BLM remonumentation survey executed under special instructions dated My 3, 1957 included under Group No. 350. BLM field notes state:  
 The 1/4 sec. cor. of secs. 3 and 34, on the S. bdy of the Tp., determined at record bearing and distance from the only remaining original bearing tree:  
 A fir snag, 34 in. diam., bears N. 25° W., 20 lks. dist., with scribed marked BT visible on open blaze.  
 At the corner point  
 Set an iron post, 28 ins. long, 2 1/2" ins. diam., 24 ins. in the ground with brass cap mkd., from which new bearing trees:  
 A fir, 12 ins. diam., bears N. 2° W., 50 lks. dist., mkd. 1/4 S34 BT.  
 A white fir, 12 ins. diam., bears S. 84 1/2° W., 74 lks. dist., mkd. 1/4 S3 BT.

Corner recovered by BLM dependent resurvey executed by Philip G. Griffin under special instructions dated July 13, 1970, June 26, 1990, and supplemental special instruction dated May 14, 1991 included under Group No. 1000 and 1484. He recovers the iron pipe monument set by Albright and find the SW tree marked by Albright dead and takes a new bearing tree. Field notes state:  
 The remains of bearing trees mkd. by Albright:  
 A fir snag 14 ins. diam., bears S. 82° W., 74 lks. dist., with fragmentary scribe marks on partially healed blaze. (Record, S. 84 1/2° W.)  
 A fir, 18 ins. diam. bears N. 4° W., 50 lks. dist., with healed blaze (Record, N 2° W.)  
 A new bearing tree:  
 A lodgepole pine, 10 ins. diam., bears S. 55 1/2° E., 24 lks. dist. mkd. 1/4 S3 BT.

**DESCRIPTION OF CORNER EVIDENCE FOUND:**

Found a 2 1/2" Iron Pipe, 3" above ground with 3" Brass cap marked as shown below from which:  
 A 15" Lodgepole Pine bears South 56° East, a distance of 15.9 feet, alive and vigorous with healed blaze.  
 A 22" Douglas Fir bears North 4° West, a distance of 33.0 feet, alive and vigorous with healed blaze.

**DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED**

**TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:**

From the iron pipe monument,

**NEW BEARING TREES:**


A 13" Western Larch bears North 75° East, a distance of 16.80 feet, marked 1/4 S34 BT.  
 A 9" Western Larch bears South 58° West, a distance of 12.60 feet, marked 1/4 S3 BT.

Corner falls in a North/South running fence.  
 I hereby certify that the corner was perpetuated July 14, 2017.

**REGISTERED  
PROFESSIONAL  
LAND SURVEYOR**

**OREGON**  
June 2, 2010  
**JEFFREY S. HSU**  
83571

Renewal Date: June 30, 2019

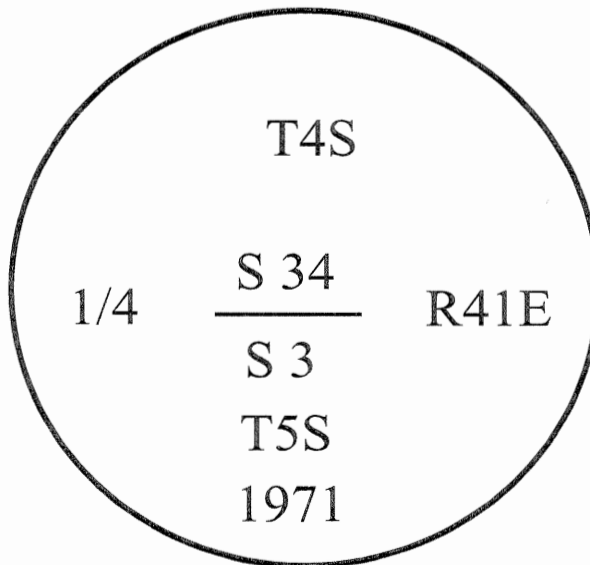

**UNION COUNTY  
SURVEYOR**

Date Received 7/19/17

Date Filed 7/19/17

Filed By

File Number 023-2017R

I used a steel tape and magnetic compass in the establishment of the bearing trees. Magnetic declination used was 13° East. Bearings are to a brass washer marked OPLS 83571 in the lower blaze of the tree. Distance is to a spike set in the root crown of the side of the tree.