
## CERTIFIED RECORD OF LAND CORNER MONUMENTATION

## HISTORY OF ORIGINAL CORNER ESTABLISHMENT:

Corner not previously established

No record of subsequent monumentation found in UNION COUNTY survey records.

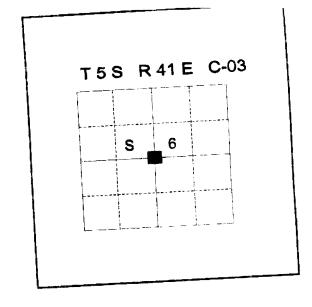

## DESCRIPTION OF CORNER EVIDENCE FOUND:

None

See Survey Number 031-2000.

## DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED

At position determined by survey, I set a 21/x30" aluminum pipe with aluminum cap marked as shown, 24" in the ground from which:


- A 11 inch diameter Ponderosa Pine bears North 54° East, a distance of 33.51
- A 16 inch diameter Ponderosa Pine bears South 33° East, a distance of 81.32
- A 15 inch diameter Douglas Fir bears South 86° West, a distance of 49.90 feet
- A 14 inch diameter Ponderosa Pine bears North 41° West, a distance of 11.55 feet marked X BT

Raised a mound of stone around monument 3 ft. base to top of cap. Set a steel fence post approximately 1 feet East of the corner monument.

I hereby certify that the corner was perpetuated on October 9, 2000.

Witnesses: Norbert Volny and Greg Blackman Jr.

REGISTERED **PROFESSIONAL** LAND SURVEYOR OREGON RICK G. ROBINSON 2219 Renewal Date December 31, 2000

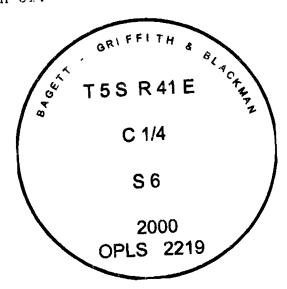

UNION COUNTY SURVEYOR Date Received 16/16/2000 File Number 031-2000 R

I used a steel tape and magnetic compass in the establishment of the new accessories. I used 17° East magnetic declination. The distance to the new accessories is to a 50d spike driven on the right side of the tree at the root crown. I attached a brass washer marked OPLS 2219 to the BT blaze.