NPW orm 76 Jun 1949 76	CADASTRAL RETHACEMENT RECORD Index
Corner Section cor. common to Sec 1, 12,	6 & 7 Twp. 5S
From original G. L. O. field notes,	dated 6-31-1879 EVIDENCE FOUND; 4-22
Corner Set stone 24 x 12 x 10	None
Witness Raised mound of stone	e at cor.
Marks	
From re-establishment field notes, dated	
Corner	
Witness	Date Received
Marks	A OREGON SS /
	By By By By
R40E R41E	File No. 714-84R
	CEMENT NOTES:
2 Sec. +	North from cor. common to Sec. 12, 13, 7 & 18; west from cor. common to to sec. 5, 6, 7 & 8; east from cor. common to 1, 2, 11 & 12. courth
	from 1/4 cor. common to Sec 1 & 6. Set brass cap in concrete
	intersection of the 4 compass lines. Set steel fence post along side
	corner
11 Sec12 Sec	
	Oregon License No. 3780 Milliamillo Aragas
	June 10, 1975 William W. Briggs, P.E Senior Vice President
	C-C-D ENGINEERS, INC.

#### CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:


Corner originally established by Henry M. Thatcher under GLO contract number 320 dated April 1, 1879. Surveyor General record states:

Set stone 24x12x10 for cor to secs 1,6,7 and 12 Raised stone mound at cor

Corner was remonumented June 10, 1975 by William W. Briggs His record states:

Set brass cap in concrete

Set steel fencepost along side corner

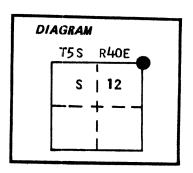

No record of subsequent remonumentation found in county records Description of corner evidence found:

Found a 31g1 brass plaque in concrete marked as shown below.

Corner falls 56 feet North of the North bank of Catherine Creek, 40 feet East of an existing North-South pole fenceline and 165 feet South of the centerline of State Highway Number 203

Description of monument and accessories I established to perpetuate the original location of this corner: From the existing corner monument as described above:

New BTs and BOs


A 26 inch diameter P.Pine bears N34°E 46.98 feet with 3/8"x9" nail in right side A 19 inch diameter Cottonwood bears S64°E 28.26 feet with 3/8"x9" nail in right side A 5/8"x30" iron pin with plastic cap marked BGA SURVEY MARKER bears \$560W 50.58 feet 043 feet East of an existing fencepost (wooden)

A 5/8"x30" iron pin with plastic cap marked BGA SURVEY MARKER bears N46°W 51.80 feet

0.3 feet East and South of an existing wooden fencepost

Did not scribe or paint trees as this corner falls in Catherine Creek State Park.

Corner rehabilitated May 28, 1986 Witnesses: Greg Blackman and Rick Robinson

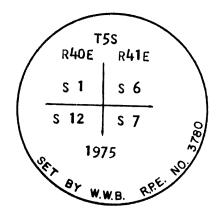

**Duane** I. Griffith

REGISTERED

PROFESSIONAL AND SURVEYOR

> Used steel tape and magnetic compass with 20° East magnetic declination. The distances to the BTs are to the nail driven in the right side of the tree, when facing the tree.

Office of	the within instrument was filed in this off. , 19	
(COUNTY OFFICIAL)		Date Received 6-5-86
Form R6-7100-57 (9/71)	☆U.S. GOVERNMENT PRINTING	Date Filed 6-18-86  C.LANGUIR DEPUTY  DEBICE - 1983-793-276
		File No. 79-86 R

### LAND CORNER MONUMENTATION

### History of original corner established:

Corner originally established by Henry M. Thatcher under GLO contract number 320 dated April 1, 1879. Surveyor General record notes states: Set stone 24x12x10 for cor secs 1,6,7 and 12 Raised stone mound at cor

Corner was remonumented June 10, 1975 by William W. Briggs. His record states:

Set brass cap in concrete

Set steel fence post along side corner

Corner Bearing Trees and Reference Points set by Duane Griffith May 28, 1986.

No record of subsequent monumentation found in Union County survey record.

# DIAGRAM T5S R40F E-25 S 12

### Description of corner evidence found:

Found a 3-1/2" brass plaque in concrete marked as shown below.

Found a 28—inch (26—inch) diameter Ponderosa Pine bears N34°E 46.98 feet with (3/8"x9") nail in right side.

Found a 22-inch (20-inch) diameter Cottonwood bears S64°E 28.3 feet, no nail found but nail hole evident on right side.

Found 5/8" iron rod with plastic cap marked BGA SURVEY MARKER bears S56°W 50.50 (50.58)

feet and is 0.3 feet East of wood fence post.
Found 5/8" iron rod with no plastic cap bears N46'W 51.60 (51.80) feet and is 0.3 feet East and South of wood fence post.

Corner lies 56 feet North of the north bank of Catherine Creek, 40 feet East of a north—south pole fence, 165 feet South of the centerline of State Highway Number 203 and at the back (West) of Catherine Creek State Park vehicle pad for campsite number 3, just below ground surface.

## Description of monument and accessories I established to perpetuate the original location

From the existing corner monument as described above:

#### Accessories set:

Railroad spike on north side of concrete form around corner monument.

Section 6 — RP: 5/8" by 30" iron rebar with red plastic cap stamped STATE PARK TRAVERSE POINT set to the right side of a 33—inch Ponderosa Pine, the rod bears N8°E, 33.30 feet.

- BT: placed an Oregon State Parks Bearing Tree tag on a 28-inch (26-inch) diameter Ponderosa Pine bears N34 E 46.98


feet with (3/8"x9") nail in right side.

Section 7 — RP: 5/8" by 30" iron rebar with red plastic cap stamped STATE PARKS TRAVERSE POINT on the right side of a 22-inch (20-inch) diameter Cottonwood bears S64 E 28.3 feet, placed an Oregon State Parks bearing tree tag on Cottonwood

with reference to iron rod as S57°E 28.21 feet.

Section 12— RP: set carsonsite survey monument post behind found 5/8" iron rod with plastic cap marked BGA SURVEY MARKER bears S56 W 50.50 feet and is 0.3 feet East of wood

Section 1- RP: set carsonsite survey monument post behind found 5/8" iron rod with no plastic cap bears N46'W 51.60 feet and is 0.3 feet East and South of wood fence post.

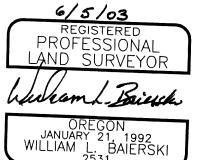

RENEWAL DATE 12/31/03

Corner was visited and additional accessories established as described above on May 14, 2003. Witnesses: Dean Timmerman.

I used a total station to establish the reference monuments.

	Ţ	55	
	R40E	R41E	
SET BY	S1 S12 T3S 19	S6 S7 R37E 75	3780

UNION COUNTY SURVEYOR
Date Received 6/9/03
Date Flort 6/14/03
By R. Robinson Deputy
File No