

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

---

INDEX NO. J-19

**History of original corner establishment:**

This corner was originally established by Henry M. Thatcher under GLO Contract No. 320, dated April 1, 1879. The Surveyor General Record states:

**DIAGRAM**  
T5S R41E  
S11  
1/4 ---o---  
S14

Set stone 17x11x8 for 1/4 Sec. Cor., from which :  
A Fir 20" in dia., bears N50°W, 40 lks. dist.  
A Fir 12" in dia., bears S71°E, 18 lks. dist.

In 1990, the Bureau of Land Management (BLM) conducted a Dependent resurvey in T.05S., R41E., W.M., under Group Nos. 1000 and 1484. This survey was executed by Philip G. Griffin, Cadastral Surveyor, and commenced by July 9, 1990 and was completed April 13, 1992. The following is the BLM's record for this corner.

From the 1/4 sec. cor. of Secs. 11 and 14, monumented with the original slate stone, 17x11x3" (record 17x11x8"), firmly set, projecting 6" above ground, with illegible chisel marks on the S. face. At the corner point set a stainless steel post, 28" long, 2 1/2" dia., 24" in the ground, with brass cap marked: SEE DIAGRAM, from which new bearing trees: a Larch, 9" dia., bears N77°E, 39 lks. dist., marked 1/4 S11 BT. A Lodgepole Pine, 14" dia., bears S58°E, 41 lks. dist., marked 1/4 S14 BT. Deposit a white "DEEP-1" magnetic marker at the base and the corner stone alongside the stainless steel post.

**Description of Corner Evidence Found:**

Found a 2 1/2" dia., stainless steel post with brass cap marked as shown in DIAGRAM, extending 4" from the ground in a mound of stone. Monument is solid and in good condition.

A Western Larch, 9" dia., with blaze pitched over, bears N77°E, 25.74 ft. (Established by BLM)  
A Lodgepole Pine, 14" dia., with blaze pitched over, bears S58°E, 27.06 ft. Established by BLM).



Found no evidence of the original bearing trees.

**Description of monument and accessories I established to perpetuate the original location of this corner:**



No work is needed on the monument. Found a steel post with 54-9 sign attached alongside monument. From Which:  
Douglas Fir, 7" dia., bears S27°E, 40.3 ft., scribed: 1/4 S14 BT  
Douglas Fir, 13" dia., bears N20°E, 7.8 ft., scribed: 1/4 S11 BT

Measurements to BT's taken with magnetic compass, with the declination set at 20°E and chain. Nailed Bearing Tree (54-3) signs above blaze and Land Survey Monument (54-9) signs on back of each tree as required. Painted a 6" red band above Bearing Trees signs. Set 1/2" brass disc at base of blaze stamped: "L. MILLER PLS 2513".

This corner maintenance was performed by:  
Linda Lee Miller, PLS 2513  
May 21, 1995

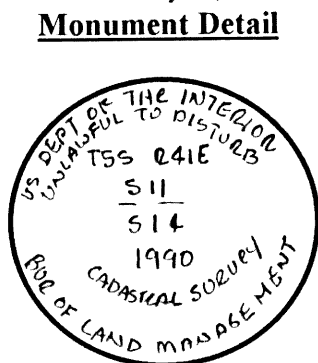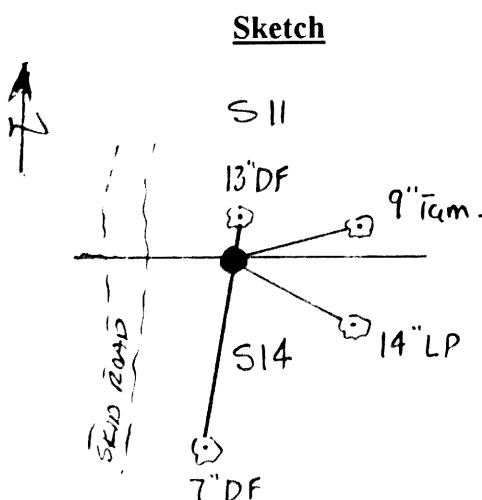

Location/Comments  
Mean Magnetic Declination 20° East

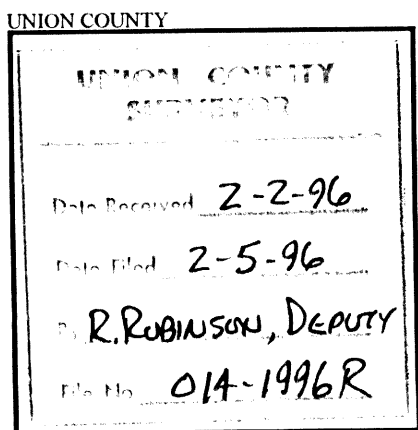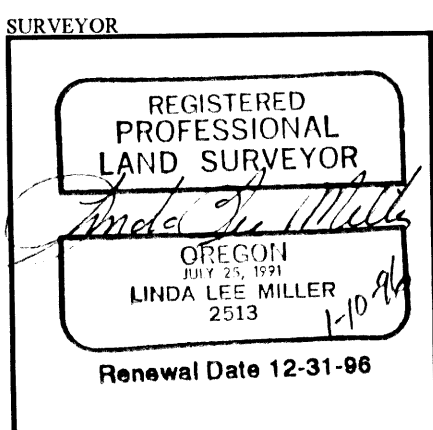

Dependent Resurvey of a Portion of the Subdivisional Lines,  
T. 5 S., R. 41 E., Willamette Meridian, Oregon

CHAINS	<p>N 1/16 S 15   S 14 1991</p>
	<p>from which</p> <p>A larch, 13 ins. diam., bears S. 11½° E., 62 lks. dist., mkd. N 1/16 S14 BT.</p> <p>A Douglas fir, 20 ins. diam., bears N. 34° W., 50 lks. dist., mkd. N 1/16 S15 BT.</p> <p>Deposit a white "DEEP-1" magnetic marker at the base of the stainless steel post.</p>
67.00	Ascend SW. slope.
81.920	<p>The cor. of secs. 10, 11, 14, and 15, monumented with the original slate stone, 12 x 10 x 4 ins. (record, 16 x 12 x 6 ins.), firmly set 3 ins. in the ground at the edge of an old stone mound, mkd. with 3 grooves on the E. face and 2 grooves on the S. face.</p> <p>At the corner point</p> <p>Set a stainless steel post, 28 ins. long, 2½ ins. diam., 24 ins. in the ground, and in a collar of stone, with brass cap mkd.</p>
	<p>T 5 S R 41 E S 10   S 11 S 15   S 14 1990</p>
	<p>from which new bearing trees</p> <p>A ponderosa pine, 16 ins. diam., bears N. 72° E., 69 lks. dist., mkd. T5S R41E S11 BT.</p> <p>A ponderosa pine, 20 ins. diam., bears S. 21° E., 25 lks. dist., mkd. T5S R41E S14 BT.</p> <p>A larch, 13 ins. diam., bears S. 54° W., 91 lks. dist., mkd. T5S R41E S15 BT.</p> <p>A ponderosa pine, 9 ins. diam., bears N. 9½° W., 126 lks. dist., mkd. T5S R41E S10 BT.</p> <p>Deposit a white "DEEP-1" magnetic marker at the base and the corner stone alongside the stainless steel post.</p>
	<p>From the ¼ sec. cor. of secs. 11 and 14, monumented with the original slate stone, 17 x 11 x 3 ins. (record, 17 x 11 x 8 ins.), firmly set, projecting 6 ins. above ground, with illegible chisel marks on the S. face.</p> <p>At the corner point</p> <p>Set a stainless steel post, 28 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.</p>

<b>UNION COUNTY SURVEYOR</b>	
Date Received	3/5/13
Date Filed	3/5/13
By	<i>[Signature]</i>
File No.	C72-2013R

450

Dependent Resurvey of a Portion of the Subdivisional Lines,  
T. 5 S., R. 41 E., Willamette Meridian, Oregon

CHAINS	
	<p style="text-align: center;">T 5 S R 41 E S 11 <math>\frac{1}{4}</math> ——— S 14 1990</p> <p>from which new bearing trees</p> <p>A larch, 9 ins. diam., bears N. 77° E., 39 lks. dist., mkd. <math>\frac{1}{4}</math> S11 BT.</p> <p>A lodgepole pine, 14 ins. diam., bears S. 58° E., 41 lks. dist., mkd. <math>\frac{1}{4}</math> S14 BT.</p> <p>Deposit a white "DEEP-1" magnetic marker at the base and the corner stone alongside the stainless steel post.</p>
	<p>S. 88° 58' 00" W., bet. secs. 11 and 14.</p> <p>Descend broken W. slope.</p>
39.600	<p>The cor. of secs. 10, 11, 14, and 15.</p> <hr/> <p>N. 0° 38' 30" W., bet. secs. 10 and 11.</p> <p>Ascend SW. slope through medium timber and light undergrowth.</p>
3.40	<p>Spur, slopes W.; over broken W. slope.</p>
23.80	<p>Rocky spur, slopes SW.</p>
39.950	<p>The <math>\frac{1}{4}</math> sec. cor. of secs. 10 and 11, determined at the center of the remains of a mound of stone crushed by a bulldozer, with a broken piece of the original stone, 8 x 6 x 4 ins. (record, 15 x 11 x 11 ins.), alongside, mkd. <math>\frac{1}{4}</math>.</p> <p>At the corner point</p> <p>Set a stainless steel post, 28 ins. long, 2½ ins. diam., 22 ins. in the ground, and in a collar of stone, with brass cap mkd.</p>
	<p style="text-align: center;">T 5 S R 41 E S 10   S 11 <math>\frac{1}{4}</math> 1990</p> <p>from which new bearing trees</p> <p>A fir, 15 ins. diam., bears N. 78° E., 36 lks. dist., mkd. <math>\frac{1}{4}</math> S11 BT.</p> <p>A fir, 12 ins. diam., bears S. 54½° W., 48 lks. dist., mkd. <math>\frac{1}{4}</math> S10 BT.</p> <p>Deposit a white "DEEP-1" magnetic marker at the base and the remains of the corner stone alongside the stainless steel post.</p> <hr/> <p>N. 0° 08' 00" W., beginning new measurement.</p>

**UNION COUNTY  
SURVEYOR**

---

Date Received 3/5/13

Date Filed 3/5/13

By *DLG/ML*

File No. C72-2013K