

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

INDEX NO. K-15

History of original corner establishment:

None. Corner established this survey.

DIAGRAM
 T5S R41E
 C
 NI/16 : S15
 C
 1994

Description of Corner Evidence Found:

None. Corner established this survey.

Description of monument and accessories I established to perpetuate the original location of this corner:

Set 2" O.D. x 30" ~~galvanized iron~~ ^{ALUMINUM} pipe 6" in ground with 2" aluminum cap, with magnet and flared ends, stamped as shown on the DIAGRAM, in a mound of stone. Solid rock at ground surface, placed in large mound of stone 4+ ft. at base x 3 ft. high.

From Which:


Ponderosa Pine, 12" dia., bears N24°28'E, 35.9 ft., scribed: CN 1/16 S15 BT

Douglas Fir, 12" dia., bears S45°49'W, 46.7 ft., scribed: CN 1/16 S15 BT


Measurements to BT's taken with total station and chain with bearings based on the survey control network; bearings taken to an 8" spike set at top of blaze, extending out 2"+/-. Nailed Bearing Tree (54-3) signs above blaze and Land Survey Monument (54-9) signs on back of each tree as required. Painted a 6" red band above Bearing Trees signs. Set 1/2" brass disc at base of blaze stamped: "L. MILLER PLS 2513". Spike and nail in brass disc on vertical line. Set steel fence post with Land Survey Monument (54-9) and Property Boundary (54-2) signs alongside monument. Set steel fence post with 54-2 sign 50' North from the monument.

This monumentation was performed by:
 Linda Lee Miller, PLS 2513
 Witnessed by:
 Russell Avery, PE, PLS
 August 24, 1994

Sketch

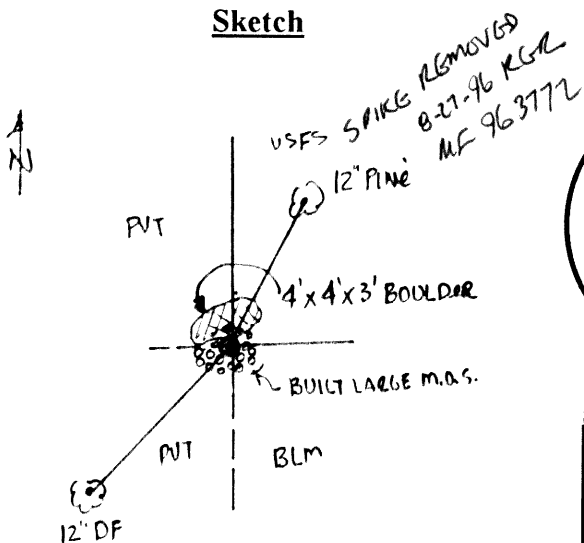

Monument Detail

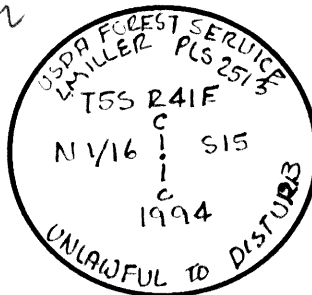

Location/Comments

Mean Magnetic Declination 20° East

SURVEYOR



UNION COUNTY

