
CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:
Corner originally established by Henry M. Thatcher under GLO contract number 320 dated April 1, 1879. Surveyor General record states:

Set stone 17x13x11 for 4 sec cor from which:

A fir 6 in dia bears N30°W 6 lks dist A tamarack 16 in dia bears S28°E 19 lks dist

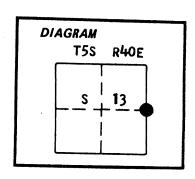

No record of subsequent remonumentation found in county records Description of corner evidence found:

Found a stone 13x11x9 inches marked 45

BTs are rotted beyond recognition

UNION COUNTY SURVEYOR
Date Received 6-5-86
Date Filed 6-18-86
By G. LANGLIE DEPUTY
File No. 76 - 86 R

Description of monument and accessories lestablished to perpetuate the original location of this corner: In place of stone, I set a 2½ x30" aluminum pipe with aluminum cap marked as shown 30 inches in the ground with small mound of stone, from which:


New BTs

A Tamarack 9 inches in diameter bears S88°E 63.73 feet marked $\frac{1}{4}$ S18 BT A 13 inch diameter Red Fir bears N21°W 13.81 feet marked $\frac{1}{4}$ S18 BT

Buried the original stone North and alongside of monument Set steel fencepost approximately 5 feet North with 54-4 sign

Corner monumented May 16, 1986 Witness: Rick Robinson

REGISTERED

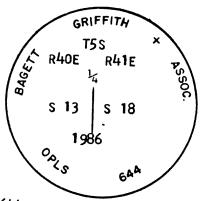

Brass washer marked OPLS 644 nailed to BT blaze. Used steel tape and magnetic compass with 20° East declination. Distances to the BTs are to a 50d spike set in right side of tree when facing tree, unless otherwise stated.

PROFESSIONAL LAND SURVEYOR

OREGON

ALV 10, 1884

DUANE 1. GRIFFITH
644

Office of	Sounty of
for record on the day of	the within instrument was filed in this office
(COUNTY OFFICIAL)	(DEPUTY)

Form R6-7100-57 (9/71)

☆U.S. GOVERNMENT PRINTING OFFICE -1983-793-276

427

Dependent Resurvey of a Portion of the West Boundary, T. 5 S., R. 41 E., Willamette Meridian, Oregon

	CHAINS	
		from which
		A ponderosa pine, 12 ins. diam., bears S. 28° E., 52 lks. dist., mkd. S 1/16 S19 BT.
		A ponderosa pine, 12 ins. diam., bears N. 7½° W., 40 ks. dist., mkd. S 1/16 S24 BT.
		Deposit a white "DEEP-1" magnetic marker at the base and set a steel fence post alongside the stainless steel post.
		The corner is located 15 lks. E. of a barbed wire fence, extending N. and S.
2	7.00	Top of ascent; along E. slope.
4	0.200	The ½ sec. cor. of secs. 19 and 24, perpetuated from the original corner stone, no longer visible, and recorded by Duane I. Griffith, Registered Land Surveyor No. 644, in 1986, recorded under file No. 64-86R, monumented with an aluminum post, $2\frac{1}{2}$ ins. diam., firmly set with top flush with the ground, and in a collar of stone, $2\frac{1}{2}$ ft. base, to top, with aluminum cap mkd.
ŕ		BAGETT GRIFFITH ASSOC T 5 S R 40 E \(\frac{1}{2} \) R 41 E S 24 S 19 1986
UNION CO		OPLS 644
SURVEY	OR	from which bearing trees mkd. by Griffith
Date Received	3/5/13	A ponderosa pine, 18 ins. diam., bears S. 10° E., 99 lks dist., with fragmentary scribe marks on partially healed double blaze.
Date Filed 3	3/5/13	A ponderosa pine, 18 ins. diam., bears N. 49° W., 131½ lks. dist., with fragmentary scribe marks on partially healed double blaze.
By /// DA	Min o	A steel fence post is set alongside the aluminum post.
File No	4-2013R	The corner is located at the top of a steep NE. slope 60 lks. E.
COLUMN TO THE PROPERTY OF THE		of a barbed wire fence, extending N. and S.
		From the ¼ sec. cor. of secs. 13 and 18 perpetuated and recorded by Duane I. Griffith, Registered Land Surveyor No. 644, in 1986, recorded under file No. 76-86R, monumented with an aluminum post, 2½ ins. diam., firmly set in a collar of stone, with top flush with the ground, with aluminum cap mkd.
	According to the particular state of the particular st	BAGETT GRIFFITH ASSOC
		T 5 S R 40 E ½ R 41 E S 13 S 18 1986
		OPLS 644
		from which bearing trees mkd. by Griffith

Dependent Resurvey of a Portion of the West Boundary, T. 5 S., R. 41 E., Willamette Meridian, Oregon

Î	CHAINS	
		A larch, 11 ins. diam., bears East, 97 lks. dist., with healed double blaze.
		A Douglas fir, 14 ins. diam., bears N. 23° W., 20½ lks. dist., with fragmentary scribe marks visible on partially healed double blaze.
		Find the original stone, 13 x 11 x 9 ins., mkd. $\frac{1}{4}S$ on one face, buried alongside the aluminum post.
		N. 0° 05′ 00" W., bet. secs. 13 and 18.
	0.15	Barbed wire fence, bears E. and W.; desc. over NE. slope, through medium timber and undergrowth.
	40.225	Point for the cor. of secs. 7, 12, 13, and 18, at proportionate distance; there is no remaining evidence of the original corner.
		Set a stainless steel post, 28 ins. long, 2½ ins. diam., 22 ins. in the ground, with brass cap mkd.
		T 5 S R 40 E R 41 E S 12 S 7 S 13 S 18 1990
		from which
		A Douglas fir, 11 ins. diam., bears N. 42½° E., 96 lks. dist., mkd. T5S R41E S7 BT.
		The marks BXO on a rock outcrop, 2 ft. x 2 ft. x 1½ ft. above ground, placed there by Duane I. Griffith, Registered Land Surveyor No. 644, in 1986, bear S. 8½° E., 58½ lks. dist.
		A fir, 10 ins, diam., bears S. 62° W., 44 lks. dist., mkd. T5S R40E S13 BT.
gentasen annte e constitue de la constitue de	egapaan nyo oga di ilia di irramuna inini di inispondo in 1905 in 1906 in 1906 in 1906 in 1906 in 1906 in 1906	A ponderosa pine, 10 ins. diam., bears N. 20° W., 24 lks. dist., mkd. T5S R40E S12 BT.
9	COUNTY /EYOR 3/5//3 3/5/13	From this point, a point established as the cor. of secs. 7, 12, 13, and 18 by W. W. Briggs, Oregon Registered Engineer No. 3780, in 1975, bears S. 7° 36' W., 0.249 chs. dist. This position was established by improper methods and is not utilized in this survey; monumented with a brass cap, 3 ins. diam., firmly set in cement flush with the ground surface, with top mkd. T5S R40E R41E S12 S7 S13 S18 1975 SET BY WWB RPE NO 3780, from which the remains of bearing trees mkd. by Briggs:
ey ILL G	Mlbr	A sawed pine stump, 15 ins. diam., bears N. 26° E., 72 lks. dist., with no marks.
File No.	74-20131V	A sawed fir stump, 17 ins. diam., bears S. 20° E., 5 lks. dist., with no marks.
		A sawed fir stump, 13 ins. diam., bears S. 29½° W., 15 lks. dist., with no marks.