

CERTIFIED RECORD OF LAND CORNER MONUMENTATION


History of original corner establishment:

40.35 Point for the 1/4 sec. cor. of secs. 26 and 27, at proportionate distance; there is no remaining evidence of the original corner. Set a stainless steel post, 28 ins. long, 2 1/2 ins. diam., 24 ins. in the ground, with brass cap, from which:

A larch, 10 ins. diam., bears N.28 1/4°E., 22 lks. dist. mkd. 1/4 S27 BT.

A larch, 11 ins. diam., bears N.79 1/2°W., 12 lks. dist. mkd. 1/4 S27 BT.

Deposit a white "DEEP-1" magnetic marker at the base of the stainless steel post.

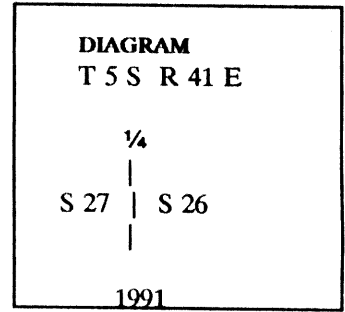

Description of corner evidence found:

Found a 2 1/2 " B.L.M. brass cap, 8" above ground from which:

A tamarack, 11" diam., bears N.78°43'W., 8.48', with a 1.5' blaze scribed "1/4 S27BT".

A tamarack, 10" diam., bears N.28°26'E., 14.17', with a 1.25' blaze, scribed "1/4 S26BT".

Description of monument and accessories I established to perpetuate the original location of this corner:

A tamarack, 9" diam., bears S.64°00'E., 16.58', scribed "1/4 S26BT".

A tamarack, 12" diam., bears S.14°21'W., 25.68', scribed "1/4 S27BT".

UNION COUNTY SURVEYOR

Date Received 10/10/94

Date Filed 10/23/94

By [Signature]

File No. 113-1994 R

REGISTERED
PROFESSIONAL
LAND SURVEYOR

[Signature] 10/94

OREGON
JULY 15 1983
RONALD E. STOLL
2058

Office of _____ County of _____
State of _____ I hereby certify that the within instrument was filed in this office
for record on the ____ day of _____, 19__

_____ by _____
(COUNTY OFFICIAL) (DEPUTY)

R

T-17

Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 5 S., R. 41 E., Willamette Meridian, Oregon

CHAINS	<p>From the cor. of secs. 25, 26, 35, and 36.</p> <p>N. 89° 57' 00" W., bet. secs. 26 and 35.</p> <p>Ascend gradually over NE. slope, through medium timber and light undergrowth.</p> <p>6.00 Descend NW. slope.</p> <p>30.00 Graveled road, 35 lks. wide, bears irregularly N. and S.</p> <p>38.40 Stream, 5 lks. wide, course N.</p> <p>40.300 Point for the ¼ sec. cor. of secs. 26 and 35, at proportionate distance; the true corner point cannot be determined from the remains of the original evidence, the original unmarked slate stone, 15 x 11 x 5 ins., buried, displaced, and broken into two pieces.</p> <p>At the corner point</p> <p>Set a stainless steel post, 28 ins. long, 2½ ins. diam., 28 ins. in the ground, the top flush with the surface, with brass cap mkd.</p> <p style="text-align: center;">T 5 S R 41 E S 26 ¼ S 35 1991</p> <p>from which new bearing trees</p> <p>A spruce, 23 ins. diam., bears N. 23½° E., 126 lks. dist., mkd. ¼ S26 BT.</p> <p>A larch, 14 ins. diam., bears S. 81° E., 32 lks. dist., mkd. ¼ S35 BT.</p> <p>Deposit a white "DEEP-1" magnetic marker at the base and the original corner stone alongside the stainless steel post.</p> <p>The corner is located in the center of an abandoned road, 15 lks. wide, bears NE. and SW., in a curve.</p> <p>Ascend broken SE. slope through logged area.</p> <p>65.00 Broad spur, slopes N.; continue over broken land.</p> <p>80.600 The cor. of secs. 26, 27, 34, and 35.</p> <hr/> <p>N. 1° 11' 30" E., bet. secs. 26 and 27.</p> <p>Along gradual W. slope, through medium timber and light undergrowth.</p>
40.350	Point for the ¼ sec. cor. of secs. 26 and 27, at proportionate distance; there is no remaining evidence of the original corner.

UNION COUNTY SURVEYOR	
Date Received	3/5/13
Date Filed	3/5/13
By	<i>[Signature]</i>
File No.	127-2013R

442

Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 5 S., R. 41 E., Willamette Meridian, Oregon

CHAINS

Set a stainless steel post, 28 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.

T 5 S R 41 E
S 27 | S 26
1991

from which

A larch, 10 ins. diam., bears N. 28¼° E., 22 lks. dist., mkd. ¼ S26 BT.

A larch, 11 ins. diam., bears N. 79½° W., 12 lks. dist., mkd. ¼ S27 BT.

Deposit a white "DEEP-1" magnetic marker at the base of the stainless steel post.

80.700

Descend NE. slope, through medium timber and light undergrowth.

The cor. of secs. 22, 23, 26, and 27, monumented with the original slate stone, 12 x 10 x 4 ins. (record, 14 x 12 x 6 ins.), firmly set at the center of an old stone mound, projecting 9 ins. above ground, with 3 grooves on the E. face.

At the corner point

Set a stainless steel post, 28 ins. long, 2½ ins. diam., 22 ins. in the ground, and in a mound of stone, 4½ ft. base, to top, with brass cap mkd.

T 5 S R 41 E
S 22 | S 23
S 27 | S 26
1991

from which new bearing trees

A fir, 15 ins. diam., bears N. 42° E., 120 lks. dist., mkd. T5S R41E S23 BT.

A ponderosa pine, 16 ins. diam., bears S. 55½° E., 128 lks. dist., mkd. T5S R41E S26 BT.

A larch, 11 ins. diam., bears S. 38° W., 119 lks. dist., mkd. T5S R41E S27 BT.

A larch, 15 ins. diam., bears N. 58° W., 84 lks. dist., mkd. T5S R41E S22 BT.

Deposit a white "DEEP-1" magnetic marker at the base and the corner stone alongside the stainless steel post.

The corner is located on a rocky W. slope.

UNION COUNTY
SURVEYOR

Date Received

3/5/13

Date Filed

3/5/13

By

[Signature]

File No.

127-2013R