


**CERTIFIED RECORD OF LAND CORNER MONUMENTATION**

T-23

Center 1/4 Section Corner of Section 25, T.5S., R.41E., W.M.

**History of original corner establishment:**

The position for this corner was originally protracted by the plat of the survey that was performed by **Henry M. Thatcher**, U.S. Deputy Surveyor, Contract Number 320, during **1879**, which was the original subdivision of T.5S., R.41E.

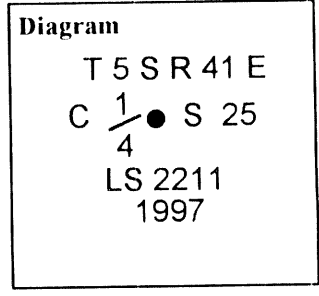

**Description of corner evidence found:**

I found no evidence of at this corner location.

**Description of monument and accessories I established to perpetuate the original location of this corner:**

At the point for the Center 1/4 section corner of section 25, established by section subdivision.

Set an aluminum post, 30 ins. long, 3 ins. in diam., 24 ins. in the ground, with an aluminum cap marked as shown in the diagram above.

From which:

A Western Larch, 10 ins. diam., bears N. 28° E., 23.0 feet dist., marked C 1/4 S25 BT, in a double blaze, with a brass washer marked LS 2211 nailed below the "T".

A White Fir, 18 ins. diam., bears N. 84° W., 29.7 feet dist., marked C 1/4 S25 BT, in a double blaze, with a brass washer marked LS 2211 nailed below the "T".

Set a 1/2 ins. diam. by 24 ins. long, rebar, 22 ins. in the ground, bears S. 31° E., 56.5 feet distant, with brass washer mkd. LS 2211, RM 1, wire to the rebar.

Set a 1/2 ins. diam. by 24 ins. long, rebar, 22 ins. in the ground, bears S. 4°30' W., 393.8 feet distant, with brass washer mkd. LS 2211, RM 2, wire to the rebar, with a collar of stone. Note: RM 1 bears N. 10° E., 349.6 feet distant from RM 2.

8/5/98  
8/29/98  
R. ROBINSON, DEPUTY  
File No. 054-1998R

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR  
Roger O. Green  
JULY 27 1988  
ROGER O. GREEN  
2211

I hereby certify that the above corner was perpetuated by me and my crew on September 30, 1997.

Compass declination used 18 1/2° East.

See also, filed survey plat.

Witnessed by crew member: Roanna K. Ruston

Current registration  
period ends 6-30-99.