


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:
Corner originally established by Henry M. Thatcher under GLO contract number 320 dated April 1, 1879. Surveyor General record states:

Set stone 16x12x8 for cor to secs 25,30,31 and 36
Raised stone mound at cor

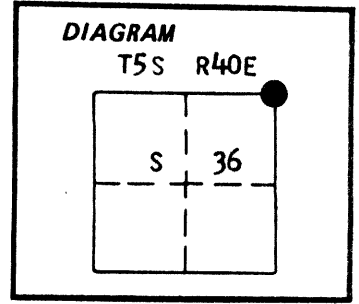

No record of subsequent remonumentation found

Description of corner evidence found:

Found a stone 16x12x6 inches marked 5/40 and 5/41 with notches in mound of stone

UNION COUNTY SURVEYOR

Date Received 6-5-86

Date Filed 6-18-86

By G. LANGLITZ, DEPUTY

File No. 56-86 R

Description of monument and accessories I established to perpetuate the original location of this corner: In place of stone, I set a 2 1/2"x30" aluminum pipe with aluminum cap marked as shown, 28 inches in the ground with mound of stone 2 ft. base to top of cap from which:

New BTs


- A 10 inch diameter White Fir bears N51°E 89.20 feet marked T5S R41E S30 BT
- A 18 inch diameter White Fir bears S76°E 47.10 feet marked T5S R41E S31 BT
- A 9 inch diameter Red Fir bears S61°W 12.13 feet marked X BT
- A 20 inch diameter Red Fir bears N49°W 47.76 feet marked T5S R40E S25 BT

Buried the original corner stone East and alongside of monument

Set steel fencepost approximately 5 feet North with 54-9 sign

Corner remonumented May 6, 1986

Witness: Rick Robinson

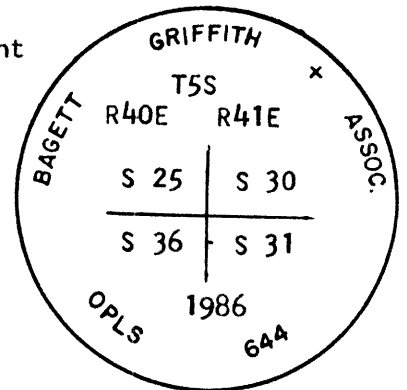

Brass washer marked OPLS 644 nailed to BT blaze. Used steel tape and magnetic compass with 20° East declination. Distances to the BTs are to a 50d spike set in right side of tree when facing tree, unless otherwise stated.

REGISTERED PROFESSIONAL LAND SURVEYOR

OREGON JULY 10, 1964
DUANE I. GRIFFITH
644

Office of..... County of.....
State of....., I hereby certify that the within instrument was filed in this office for record on the..... day of....., 19.....
..... by
(COUNTY OFFICIAL) (DEPUTY)

Dependent Resurvey of a Portion of the West Boundary,
T. 5 S., R. 41 E., Willamette Meridian, Oregon

CHAINS	
	<p>A ponderosa pine, 14 ins. diam., bears N. 52° E., 52 lks. dist., with fragmentary scribe marks on partially healed double blaze.</p>
	<p>A larch, 15 ins. diam., bears N. 48½° W., 50 lks. dist., with fragmentary scribe marks in partially healed double blaze.</p>
	<p>A steel fence post is set alongside the aluminum post.</p>
	<p>From this point, the corner of wire fences extending N. and E., bears N. 5½° W., 0.710 chs. dist.</p>
	<p>N. 0° 11' 30" E., beginning new measurement.</p>
	<p>Along W. slope and along wire fence through medium timber and light undergrowth.</p>
8.25	Ascend SW. slope.
14.50	Top of ascent; continue over rolling land along wire fence.
40.475	<p>The cor. of secs. 25, 30, 31, and 36, perpetuated from the original corner stone, no longer visible, and recorded by Duane I. Griffith, Registered Land Surveyor No. 644, in 1986, recorded under file No. 56-86R, monumented with an aluminum post, 2½ ins. diam., firmly set flush with the ground, and in a collar of stone, with aluminum cap mkd.</p> <p style="text-align: center;">BAGETT GRIFFITH ASSOC T 5 S R 40 E R 41 E S 25 S 30 S 36 S 31 1986 PLS 644</p> <p>from which bearing trees mkd. by Griffith</p> <p>A fir, 12 ins. diam., bears N. 51° E., 134 lks. dist., with fragmentary scribe marks on partially healed double blaze.</p> <p>A fir, 20 ins. diam., bears S. 75½° E., 72 lks. dist., with fragmentary scribe marks on partially healed double blaze.</p> <p>A fir, 10 ins. diam., bears S. 59¾° W., 19 lks. dist., with fragmentary scribe marks on partially healed double blaze.</p> <p>A fir, 24 ins. diam., bears N. 48½° W., 72 lks. dist., with fragmentary scribe marks on partially healed double blaze.</p> <p>A steel fence post is set alongside the aluminum post.</p>

UNION COUNTY
SURVEYOR

Date Received 3/5/13

Date Filed 3/5/13

By RDG, Kham

File No. 131-2013R