


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

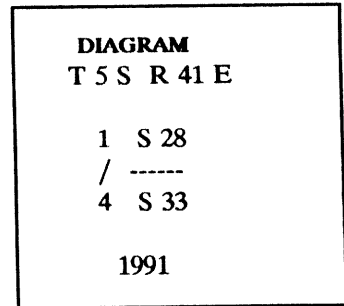

History of original corner establishment:

39.86 Point for the 1/4 sec. cor. of secs. 28 and 33 at proportionate distance; there is no remaining evidence of the original corner. Set a stainless steel post, 28 ins. long, 2 1/2 ins. diam., 22 ins. in the ground, with brass cap, from which:

A fir, 13 ins. diam., bears S.28 3/4°W., 45 lks. dist. mkd. 1/4 S33 BT.

A ponderosa pine, 19 ins. diam., bears N.44°W., 84 lks. dist. mkd. 1/4 S28 BT.

Deposit a white "DEEP-1" magnetic marker at the base of the stainless steel post.

Description of corner evidence found:

Found a 2 1/2" B.L.M brass cap, 6" above ground, with a 2' mound of stone to cap from which:

A fir, 11" diam., bears S.28°57'W., 29.60', with a 1' x 4' blaze scribed "1/4 S33BT".

A pine, 18" diam., bears N.44°28'W., 56.17', with a 1' x 4' blaze scribed "1/4 S28BT".

Description of monument and accessories I established to perpetuate the original location of this corner:

A tamarack, 15" diam., bears N.46°24'E., 44.24', scribed "1/4 S28BT".

A tamarack, 12" diam., bears S.75°43'E., 13.52', scribed "1/4 S33BT".

UNION COUNTY
SURVEYOR

Date Received 10/18/94
Date Filed 10/23/94
By [Signature]
File No. 119-1994R

REGISTERED
PROFESSIONAL
LAND SURVEYOR
[Signature] 10/94
OREGON
JULY 15 1983
RONALD E. STOLL
2058

Office of _____ County of _____
State of _____ I hereby certify that the within instrument was filed in this office
for record on the _____ day of _____, 19____
_____ by _____
(COUNTY OFFICIAL) (DEPUTY)

X

V-11

Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 5 S., R. 41 E., Willamette Meridian, Oregon

CHAINS											
	From the cor. of secs. 27, 28, 33, and 34. S. 89° 14' 00" W., bet. secs. 28 and 33. Descend NW. slope.										
19.50	Top of steep E. slope.										
19.930	Point for the E 1/16 sec. cor. of secs. 28 and 33. Set a stainless steel post, 28 ins. long, 2½ ins. diam., 22 ins. in the ground, with brass cap mkd.										
	<table style="margin-left: auto; margin-right: auto;"> <tr><td></td><td style="text-align: right;">S 28</td></tr> <tr><td>E 1/16</td><td style="text-align: right;">—</td></tr> <tr><td></td><td style="text-align: right;">S 33</td></tr> <tr><td></td><td style="text-align: right;">1991</td></tr> </table>		S 28	E 1/16	—		S 33		1991		
	S 28										
E 1/16	—										
	S 33										
	1991										
	from which A ponderosa pine, 26 ins. diam., bears N. 22° E., 18 lks. dist., mkd. E 1/16 S28 BT. A ponderosa pine, 17 ins. diam., bears S. 63° E., 43 lks. dist., mkd. E 1/16 S33 BT.										
	Along gradual S. slope.										
24.00	Ascend SE. slope.										
39.75	Barbed wire fence, bears N. and S.										
39.860	Point for the ¼ sec. cor. of secs. 28 and 33, at proportionate distance; there is no remaining evidence of the original corner. Set a stainless steel post, 28 ins. long, 2½ ins. diam., 22 ins. in the ground, and in a collar of stone, with brass cap mkd.										
	<table style="margin-left: auto; margin-right: auto;"> <tr><td>T 5 S</td><td>R 41 E</td></tr> <tr><td></td><td style="text-align: right;">S 28</td></tr> <tr><td>¼</td><td style="text-align: right;">—</td></tr> <tr><td></td><td style="text-align: right;">S 33</td></tr> <tr><td></td><td style="text-align: right;">1991</td></tr> </table>	T 5 S	R 41 E		S 28	¼	—		S 33		1991
T 5 S	R 41 E										
	S 28										
¼	—										
	S 33										
	1991										
	from which A fir, 13 ins. diam., bears S. 28¾° W., 45 lks. dist., mkd. ¼ S33 BT. A ponderosa pine, 19 ins. diam., bears N. 44° W., 84 lks. dist., mkd. ¼ S28 BT. Deposit a white "DEEP-1" magnetic marker at the base of the stainless steel post.										
	Ascend SE. slope through logged area.										
41.50	Dirt road, 20 lks. wide, bears NE. and SW.										
55.00	Descend W. slope.										

UNION COUNTY
SURVEYOR

Date Received 3/5/13
Date Filed 3/5/13
By [Signature]
File No. 13B-2013R