


RECOVERY NOTES  
PROPERTY CORNER INVESTIGATION

V 15

LOCATION

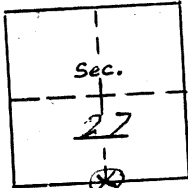

T. T55 R. 41E  
Mer. Will State OK.  
Forest W Dist. UNION

LEGEND

- Corner searched-no evidence
- Corner or accessory found
- Corner marked by perm. mon.

DESCRIPTION OF FOUND CORNER

MATERIAL: STONE SIZE: 11x9x6  
HEIGHT ABOVE GROUND: ON TOP CONDITION: POOR  
MARKINGS: FAINT X

DESCRIPTION OF FOUND ACCESSORIES

Forest service location poster with initials L.M. DATE 7/5/38 A LITTLE TO THE NORTH THERE IS A SMALL ROCK MOUND. ON TOP STONE 11x9x6 ON TOP OF MOUND HAS FAINT X. TO EE TO THE WEST IS ANOTHER POSTER DATE 7/23/37 PUT UP BY V.D. PRICHARD TAG, ROAD'S CORNERS 53908 174K'S  
NOTE: Indicate full investigative details on back of form.

PHOTO IDENTIFICATION

Symbol & date ENW-9-16 Size or roll \_\_\_\_\_ Exposure \_\_\_\_\_  
How Identified POW POINT Where filed \_\_\_\_\_

DATE: 9/30/66 RECOVERED BY: E.A.H.  
TITLE: \_\_\_\_\_

Form R6-5680-180 (4/61)


|                                  |                            |
|----------------------------------|----------------------------|
| <b>UNION COUNTY<br/>SURVEYOR</b> |                            |
| Date Received                    | _____                      |
| Date Filed                       | <u>12-28-87</u>            |
| By                               | <u>G. LANGLITZ, DEPUTY</u> |
| File No.                         | <u>436-87R</u>             |

V-15

**CERTIFIED RECORD OF LAND CORNER MONUMENTATION**

**History of original corner establishment:**

39.53 Point for the 1/4 sec. cor. of secs. 27 and 34 at proportionate distance; there is no remaining evidence of the original corner. Set a stainless steel post, 28 ins. long, 2 1/2 ins. diam., 22 ins. in the ground, with brass cap, from which:

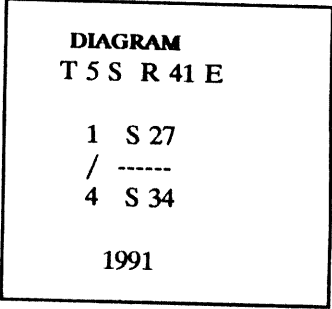

A ponderosa pine, 20 ins. diam., bears N.33°E., 45 lks. dist. mkd. 1/4 S27 BT

A ponderosa pine, 16 ins. diam., bears S.77°W., 44 lks. dist. mkd. 1/4 S34 BT.

Deposit a white "DEEP-1" magnetic marker at the base of the stainless steel post.

From this point, a monument of unknown origin, bears N.69°06'50"W., 1.022 chs. dist., a stone, 10 x 8 x 5 ins., in the center of a recently made stone mound and plainly mkd. 1/4 S. Evidence is not in accord with the observed pattern or condition of the original survey and is not regarded as evidence of the original corner position.

**Description of corner evidence found:**

Found a 2 1/2" B.L.M brass cap, 6" above ground, with a 2' mound of stone to cap from which:

A pine, 14" diam., bears S.77°30'W., 29.00', with a 1' x 1/2' blaze (not legible).

A pine, 16" diam., bears N.32°59'W., 29.80', with a 1' x 1/2' blaze (not legible).

**Description of monument and accessories I established to perpetuate the original location of this corner:**

A pine, 7" diam., bears N.16°48'E., 36.04', scribed "1/4 S27BT".

A pine, 14" diam., bears N.84°05'E., 34.86', scribed "1/4 S27BT".

UNION COUNTY SURVEYOR  
Date Received 10/10/94  
Date Filed 10/23/94  
By [Signature]  
File No. 120-1994R

REGISTERED PROFESSIONAL LAND SURVEYOR  
[Signature] 10/94  
OREGON JULY 15 1983  
RONALD E. STOLL  
2058

Office of \_\_\_\_\_ County of \_\_\_\_\_  
State of \_\_\_\_\_ I hereby certify that the within instrument was filed in this office  
for record on the \_\_\_\_\_ day of \_\_\_\_\_, 19\_\_\_\_

\_\_\_\_\_ by \_\_\_\_\_  
(COUNTY OFFICIAL) (DEPUTY)

Y

V-17

Dependent Resurvey of a Portion of the Subdivisional Lines,  
T. 5 S., R. 41 E., Willamette Meridian, Oregon

| CHAINS |   |
|--------|---|
|        | <p>A larch, 10 ins. diam., bears S. 50° E., 20 lks. dist., mkd. E 1/16 S34 BT.</p> <p>A ponderosa pine, 24 ins. diam., bears N. 78½° W., 107 lks. dist., mkd. E 1/16 S27 BT.</p> <p>Deposit a white "DEEP-1" magnetic marker at the base of the stainless steel post.</p> <p>Descend W. slope along old fence line.</p>   |
| 21.25  | Ravine, drains SW.; asc. over broken SE. slope.   |
| 37.75  | Dirt road, 20 lks. wide, bears N. 30° E. AND S. 30° W.  |
| 39.530 | <p>Point for the ¼ sec. cor. of secs. 27 and 34, at proportionate distance; there is no remaining evidence of the original corner.</p> <p>Set a stainless steel post, 28 ins. long, 2½ ins. diam., 22 ins. in the ground, and in a collar of stone, with brass cap mkd.</p> <div style="text-align: center;"> <p>T 5 S R 41 E</p> <p>S 27</p> <p>¼ ———</p> <p>S 34</p> <p>1991</p> </div> <p>from which</p> <p>A ponderosa pine, 20 ins. diam., bears N. 33° E., 45 lks. dist., mkd. ¼ S27 BT.</p> <p>A ponderosa pine, 16 ins. diam., bears S. 77° W., 44 lks. dist., mkd. ¼ S34 BT.</p> <p>Deposit a white "DEEP-1" magnetic marker at the base of the stainless steel post.</p> <p>From this point, a monument of unknown origin, bears N. 69° 06' 50" W., 1.022 chs. dist., a stone, 10 x 8 x 5 ins., in the center of a recently made stone mound and plainly mkd. ¼ S. Evidence is not in accord with the observed pattern or condition of the original survey and is not regarded as evidence of the original corner position.</p> |
| 59.295 | Ascend steep SE. slope.   |
| 59.295 | <p>Point for the W 1/16 sec. cor. of secs. 27 and 34.</p> <p>Set a stainless steel post, 28 ins. long, 2½ ins. diam., 22 ins. in the ground, with brass cap mkd.</p> <div style="text-align: center;"> <p>S 27</p> <p>W 1/16 ———</p> <p>S 34</p> <p>1991</p> </div> <p>from which</p> <p>A ponderosa pine, 13 ins. diam., bears N. 53° E., 65 lks. dist., mkd. W 1/16 S27 BT.</p>   |

UNION COUNTY  
SURVEYOR

Date Received 3/5/13

Date Filed 3/5/13

By [Signature]

File No. 142-2013R