


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

V-23

1/4 Section Corner of Sections 25 & 36, T.5S., R.41E., W.M.

History of original corner establishment:

The corner was originally established by **Henry M. Thatcher**, U. S. Deputy Surveyor, Contract Number 320, during **1879**. His record states: "Set stone 11 x 9 x 7 for 1/4 Sec. Cor. Raised stone mound at Cor."

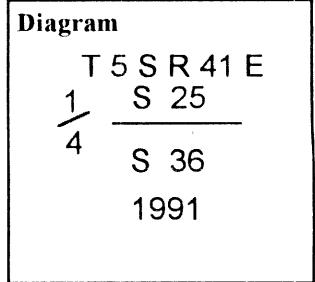

1991, Philip G. Griffin, Cadastral Surveyor, BLM, conducted a dependent resurvey in this township and monuments this corner at the proportionate distance, his record states:

"There is no remaining evidence of the original corner.

Set a stainless steel post, 28 ins. long, 2 1/2 ins. diam., 24 ins. in the ground, with brass cap mkd." (as shown in the diagram). "From which

- A lodgepole pine, 12" ins. diam., bears N. 32° E., 16 lks. dist., mkd. 1/4 S25 BT.
- A larch, 17" ins. diam., bears S. 57° W., 63 lks. dist., mkd. 1/4 S36 BT.

Deposit a white "Deep-1" magnetic marker at the base of the stainless steel post."

Description of corner evidence found:

Found a 2 1/2" stainless steel pipe & brass cap, 4 ins. above ground, marked as shown in the diagram above, from which:

BLM 1991 Bearing Trees:

- A lodgepole pine, 12" ins. diam., bears N. 32° E., 10.4 ft. dist. (record 10.6 ft.), scribed "1/4 S25 BT".
- A larch, 17" ins. diam., bears S. 57° W., 41.0 ft. dist. (record 41.6 ft.), scribed "1/4 S36 BT".

Description of monument and accessories I established to perpetuate the original location of this corner:

From the brass cap, I established the following references:

- Set a 1/2 ins. diam. by 24 ins. long, rebar, 23 ins. in the ground, S. 31° E., 138.4 feet, with brass washer mkd. LS 2211, RM 2, wire to the rebar, with a collar of stone.
- Set a 1/2 ins. diam. by 24 ins. long, rebar, 23 ins. in the ground, S. 38° W., 126.2 feet, with brass washer mkd. LS 2211, RM 1, wire to the rebar, with a collar of stone.

I set steel post with a Property Boundary & a Land Survey Monument sign, North on line, 3.0 feet from the monument. Also, I set steel post with a Property Boundary sign, East on line, 3.0 feet from the monument.

I hereby certify that the above corner was perpetuated by me and my crew on August 28, 1997.

Compass declination used 18 1/2° East.

See also, filed survey plat.

Witnessed by crew member: Roanna K. Ruston

WALLOWA COUNTY
 REGISTERED
 PROFESSIONAL
 LAND SURVEYOR
 R. ROBINSON, DEPUTY
 056-1998R

REGISTERED
 PROFESSIONAL
 LAND SURVEYOR
 ROBERT O. GREEN
 2211

Current registration period ends 6-30-99.

Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 5 S., R. 41 E., Willamette Meridian, Oregon

CHAINS	
	<p>A larch, 25 ins. diam., bears N. 10° E., 19½ lks. dist., with healed blaze. (Record, N. 2° E., 18 lks.)</p> <p>A root hole, bears N. 60° W., 25 lks. dist., with lodgepole pine log alongside, 13 ins. diam., with fragmentary scribe marks visible on opened blaze. (Record, N. 70° W.)</p> <p>and bearing trees mkd. by Voelz</p> <p>A fir, 18 ins. diam., bears S. 27¾° E., 57 lks. dist., with healed double blaze.</p> <p>A fir, 15 ins. diam., bears S. 28¾° W., 40 lks. dist., with healed double blaze.</p> <p>A larch, 15 ins. diam., bears S. 89½° W., 95 lks. dist., with healed double blaze.</p> <p>No suitable trees available in sec. 26.</p> <hr/> <p>From the cor. of secs. 25 and 36, on the E. bdy. of the Tp. N. 89° 34' 00" W., bet. secs. 25 and 36.</p> <p>Descend W. slope.</p> <p>3.00 Ravine, drains N. 30° E.; asc. E. slope.</p> <p>10.00 Spur, slopes N.</p>
39.205	<p>Point for the ¼ sec. cor. of secs. 25 and 36, at proportionate distance; there is no remaining evidence of the original corner.</p> <p>Set a stainless steel post, 28 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.</p> <div style="text-align: center;"> <p>T 5 S R 41 E</p> <p>S 25</p> <hr style="width: 20%; margin: 0 auto;"/> <p>¼ S 36</p> <p>1991</p> </div> <p>from which</p> <p>A lodgepole pine, 12 ins. diam., bears N. 32° E., 16 lks. dist., mkd. ¼ S25 BT.</p> <p>A larch, 17 ins. diam., bears S. 57° W., 63 lks. dist., mkd. ¼ S36 BT.</p> <p>Deposit a white "DEEP-1" magnetic marker at the base of the stainless steel post.</p>
42.00	Ridge, bears N. and S.; desc. W. slope.
47.25	Graveled road, 20 lks. wide, bears N. and S.
51.50	Ascend over gradual NE. slope.

UNION COUNTY SURVEYOR	
Date Received	3/5/13
Date Filed	3/5/13
By	<i>AL Gilman</i>
File No.	147-2013