


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

40.74 The 1/4 sec. cor. of secs. 33 and 34, monumented with the original slate stone, 19 x 15 x 5 ins., loosely set 1 in. in the ground, mkd. 1/4 on the W. face, from which the remains of the original bearing trees:

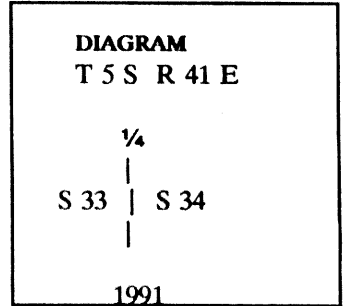

A root hole, bears S.85°E., 22 lks. dist.

A root hole, bears N.50°W., 10 lks. dist., with fir log, 38 ins. diam., alongside with open blaze, no marks remain on burned rotting face deep within.

At the corner point, set a stainless steel post, 28 ins. long, 2 1/2 ins diam., 22 ins. in the ground, with brass cap , from which :

A ponderosa pine, 18 ins. diam., bears S.21°E., 40 lks. dist. mkd. 1/4 S34 BT.

A larch, 11 ins. diam., bears S.82 1/4°W., 53 lks. dist. mkd. 1/4 S33 BT.

Deposit a white "DEEP-1" magnetic marker at the base of the stainless steel post.

The corner is located on a spur, sloping S.65°E.

Description of corner evidence found:

Found a 2 1/2" B.L.M. brass cap, 4" above ground, from which:

A pine, 15" diam., bears S.21°52'E., 22.26', with a 14" x 4" blaze (not legible).

A tamarack, 10" diam., bears S.82°24'W., 35.52', with a 16" x 4" blaze, scribed "1/4 S33 BT".

A tamarack, 10" diam., bears N.53°41'W., 15.20', scribed "1/4 S34 BT".

Description of monument and accessories I established to perpetuate the original location of this corner:

A tamarack, 9" diam., bears S.74°45'E., 26.63', scribed "1/4 S33 BT".

UNION COUNTY SURVEYOR

Date Received 10/18/94

Date Filed 10/23/94

By [Signature]

File No 132-1994R

REGISTERED
PROFESSIONAL LAND SURVEYOR

[Signature] 10/94

OREGON
 JULY 15 1983
RONALD E. STOLL
 2058

Office of _____ County of _____
 State of _____ I hereby certify that the within instrument was filed in this office
 for record on the ____ day of _____, 19__
 _____ by _____
 (COUNTY OFFICIAL) (DEPUTY)

AK

X-13

Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 5 S., R. 41 E., Willamette Meridian, Oregon

CHAINS	
20.370	<p>Point for the S 1/16 sec. cor. of secs. 33 and 34.</p> <p>Set a stainless steel post, 28 ins. long, 2½ ins. diam., 22 ins. in the ground, with brass cap mkd.</p> <div style="text-align: center;"> <p>S 1/16</p> <p>S 33 S 34</p> <p>1991</p> </div> <p>from which</p> <p>A fir, 17 ins. diam., bears N. 15° E., 49 lks. dist., mkd. S 1/16 S34 BT.</p> <p>A larch, 11 ins. diam., bears N. 59° W., 47 lks. dist., mkd. S 1/16 S33 BT.</p> <p>Deposit a white "DEEP-1" magnetic marker at the base of the stainless steel post.</p>
39.50	<p>Spring branch, 2 lks. wide, course E.</p>
40.740	<p>The ¼ sec. cor. of secs. 33 and 34, monumented with the original slate stone, 19 x 15 x 5 ins., loosely set 1 in. in the ground, mkd. ¼ on the W. face, from which the remains of the original bearing trees:</p> <p>A root hole, bears S. 85° E., 22 lks. dist.</p> <p>A root hole, bears N. 50° W., 10 lks. dist., with fir log, 38 ins. diam., alongside, with open blaze, no marks remain on burned rotting face deep within.</p> <p>At the corner point</p> <p>Set a stainless steel post, 28 ins. long, 2½ ins. diam., 22 ins. in the ground, with brass cap mkd.</p> <div style="text-align: center;"> <p>T 5 S R 41 E</p> <p>¼</p> <p>S 33 S 34</p> <p>1991</p> </div> <p>from which new bearing trees</p> <p>A ponderosa pine, 18 ins. diam., bears S. 21° E., 40 lks. dist., mkd. ¼ S34 BT.</p> <p>A larch, 11 ins. diam., bears S. 82¼° W., 53 lks. dist., mkd. ¼ S33 BT.</p> <p>Deposit a white "DEEP-1" magnetic marker at the base and the corner stone alongside the stainless steel post.</p> <p>The corner is located on a spur, sloping S. 65° E.</p>
3.00	<p>N. 0° 37' 00" W., beginning new measurement.</p> <p>Ascend S. slope.</p>

UNION COUNTY
SURVEYOR

Date Received 3/5/13

Date Filed 3/5/13

By AL Galbraith

File No. 156-2013R