
CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment: Corner originally established by W.B. Barr under GLO contract number 492 dated August 22, 1883,

Surveyor General record states:

Set most 4 ft long 4 ins square 24 ins in ground for 4 Sec cor marked 45 on W face from which

A pine 12 ins dia brs N55°E 44 lks dist marked 45 BT A pine 10 ins dia brs \$25°W 24 lks dist marked 45 BT

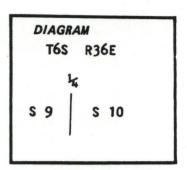

Description of corner evidence found:

Found the original Southwest bearing tree, now a 11 inch diameter lodgepole pine dead and standing with scribes visible (4SBT)

Found stump hole and badly rotted tree with no scribes visible at record bearing and distance for the other original bearing tree

Description of monument and accessories I established to perpetuate the original location of this corner: At record bearing and distance from the above described bearing tree, I set a $2\frac{1}{2}$ inch x 30 inch aluminum pipe with aluminum cap marked as shown 28 inches in the ground, from which:

New BTs

A 13 inch diameter tamarack bears \$49°E 27.6 feet marked 4 \$10 BT A 8 inch diameter tamarack bears \$64°W 29.0 feet marked 4 \$9 BT

Set steel fence post approximately 5 feet North with 54-4 sign attached

Corner set September 21, 1984 Witness: Rick Robinson T6S R36E

14

S 9 | S 10

1984

OPLS 644

PROFESSIONAL LAND SURVEYOR

GREGORY T. BLACKMAN 991 I used a steel tape and magnetic compass in the establishment of these accessories. I used 20 East magnetic declination. The distances to the new bearing trees are to the center of the tree. I painted a 6 inch red band around all BTs and attached 54-4 signs and bearing tree signs. I attached a brass washer marked OPLS 991 to the BT blaze.

Form R6-7100-57 (9/71)

Date Filed 9-25-84

By G. LANGLITZ DEPUTY

File No. 940-84 R