CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Index File No. A-3

History of original corner establishment:

Not set.

T5SR38E N 1/4 S6 T6S

Description of corner evidence found:

None.

Corner falls just East of flat ridge, about 20' below the top.

Description of monument and accessories I established to perpetuate the original location of this corner:

T5SR38E

File No. \$44-84R

At surveyed point set 2 1/2" x 30" galvanized N 1/14 S6 pipe and brass cap marked:
Set pipe 24" in the ground and mound of stone around to cap.

From which, by magnetic declination of N20°E:
A 9" tamarac bears S32°E, 20.5 ft. scribed 1/4 S6 BT.
A 9" tamarac bears S24°W, 108.5 ft. scribed 1/4 S6 BT.
Placed 54-3s and brass washers stamped PLS 1051 on BTs.
Painted blazes red and 6" red band around. Placed 54-2 and 54-4 on steel fence post 5' East of corner.

REGISTERED PROFESSIONAL LAND SURVEYOR

Barry B Barbour

OREGON
OCT. 17, 1975
BARRY B. BARBOUR
1 0 5 1

I hereby certify that the above corner monument was reestablished as herein described.

Witnesses: Robert S. Stevens Jerry Rous

September 20, 1979

Office of County Surveyor County of Union State of	n this office
for record on the 6th day of December 1979 (COUNTY OFFICAL)	UNION COUNTY SURVEYOR
Form R6-7100-57 (9/71)	Date Received
	Date Filed
	Ву

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner set by Barry B. Barbour, LS 1051, as described by File No. 744-84R, filed

December 6, 1979, in the records of the Union County Surveyor.


Record states: Corner falls just East of flat ridge, about 20' below the top.

At surveyed point set 21/2" x 30" galvanized pipe and brass cap marked (as shown below): Set pipe 24" in the ground to bedrock and mound of stone around to cap.

From which, by magnetic declination of N20°E:

A 9" tamarac [sic] bears S32°E, 20.5 ft. scribed 1/4 S6 BT.

A 9" tamarac [sic] bears S24°W, 108.5 ft. scribed 1/4 S6 BT.

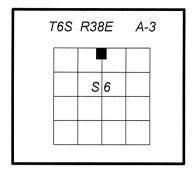


Description of corner evidence found:

Found 21/2 ins. diam. iron pipe, projecting 4 ins. above ground, with rock collar, and 21/2 ins. diam. brass cap, marked as shown:

From the recovered monument I find the Barbour bearing trees:

A tamarack snag, 9 ins. diam., bears S. 32° E., 20.5 ft. dist., with full scribe visible on open blaze.

Found guard post ±6 ft E'ly, added Land Survey Monument (54-9) sign.

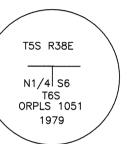

Description of monument and accessories I established to perpetuate original location of this corner:

New bearing trees:

A Douglas fir, 15 ins. diam., bears S. 47½° E., 32.3 ft. dist., mkd. 1/4 S6 BT.

A white fir, 18 ins. diam., bears S. 15° E., 46.5 ft. dist., mkd. XBT.

A ponderosa pine, 5 ins. diam., bears S. 54° W., 32.4 ft. dist., mkd. X BT on double blaze.

A ponderosa pine, 10 ins. diam., bears S. 681/2° W., 55.6 ft. dist., mkd. 1/4 S6 BT.

All new bearing trees are marked on a single blaze unless noted otherwise and have a nail with a brass washer stamped "LS 2648" right side center for distance measurements.

Painted 6 ins. red bands and added Bearing Tree (54-3) and Land Survey Monument (54-9) signs as needed to all bearing trees.

Auto C/A geographic position:

45°04'43.8" N Lat. Long. 118°06'21.1" W

I hereby certify that the corner is monumented and accessories taken as described. using a Warren Knight staff compass, set with 15° East declination, and steel tape on August 2, 2014.

Witnesses: Brenda Johnson and Jon Howells

REGISTERED **PROFESSIONAL** LAND SURVEYOR

Jeceased

OREGON JANUARY 18, 1994 RON C. WALTER 2648

Renewal Date: June 30, 2016

REGISTERED PROFESSIONAL LAND SURVEYOR

OREGON July 22, 1977
WILLIAM R. WELLS

1106 Renewal Date: June 30, 2016

UNION COUNTY **SURVEYOR** Date Received Date Filed File No.

NOTE: See "Explanation for Successor Certifying Surveyor" statement in Narrative of Record of Survey, CS 010-2015, filed concurrently with this Land Corner Record.