## CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Index File No. A-7

History of original corner establishment: None.

DIAGI	IAM		
T5	S R38	3E	
1/	4   5	35	
	T6S		

Description of corner evidence found:

Not Set.

Corner is 76.9 ft. East of 1/4 corner for section 32.

Description of monument and accessories I established to perpetuate the original location of this corner:

At surveyed point set 2 1/2" X 30" galvanized pipe and brass cap marked: Set pipe 20" in the ground and mound of stone around to cap.

T5S R38E 1/4 | 55 OR PLS 1051 1980

From which by magnetic declination of N20°E: A 16" Pine bears S16°E, 84.0 ft. scribed 1/4S5 BT. A 10" Fir bears S54°W, 43.4 ft. scribed 1/4S5 BT. Placed C.Z., BT tags, oc. tags and property corner tags. Placed loc. tags on 20" Pine 5' NW of cor. Placed 54-2 and 54-4 on steel fence post 5' East of the corner.

> REGISTERED PROFESSIONAL LAND SURVEYOR

OREGON OCT. 17, 1975 BARRY B. BARBOUR

I hereby certify that the above corner monument was reestablished as herein described.

Witnesses: Daniel T. Rowland Robert Boling

June 4, 1980

	day of J. U. 1	ify that the within instrument was f	UNION COUNTY
	(COUNTY OFFICIAL)	(DEPUTY)	SURVEYOR
R6-7100-57 (	9/71)		Date Received
			Date Filed

### CERTIFIED RECORD OF LAND CORNER MONUMENTATION

#### History of original corner establishment:

Corner set by Barry B. Barbour, LS 1051, as described by File No. 746-84R, filed July 3, 1980, in the records of the Union County Surveyor.


Record states: Corner is 76.9 ft. East of  $\frac{1}{4}$  corner for section 32.

At surveyed point set 21/2" x 30" galvanized pipe and brass cap marked (as shown below): Set pipe 20" in the ground and mound of stone around to cap.

From which, by magnetic declination of N20°E:

A 16" Pine bears S16°E, 84.0 ft. scribed 1/4 S5 BT.

A 10" Fir bears S54°W, 43.4 ft. scribed 1/4 S5 BT.

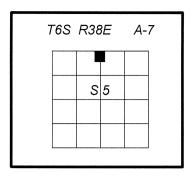

#### Description of corner evidence found:


Found 2½ ins. diam. iron pipe, projecting 6 ins. above ground, with rock collar, and 2½ ins. diam. brass cap, marked as shown:

From the recovered monument I find the Barbour bearing trees:

A ponderosa pine, 20 ins. diam., bears S. 16° E., 84.0 ft. dist., alive with full scribe visible on open double blaze.

A Douglas fir, 15 ins. diam., bears S. 54° W., 43.4 ft. dist., alive with 4S visible on partially healed

Found guard posts ±5 ft W'ly with Property Boundary (54-2) and Land Survey Monument (54-9) signs attached and ±5 ft. E'ly with Property Boundary (54-2) sign attached.

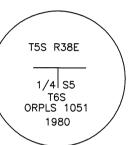

#### Description of monument and accessories I established to perpetuate original location of this corner:

New bearing trees:

A Douglas fir, 9 ins. diam., bears S. 693/4° E., 55.3 ft. dist., mkd. XBT.

A ponderosa pine, 6 ins. diam., bears S. 1° W., 40.1 ft. dist., mkd. X BT on double blaze.

All new bearing trees are marked on a single blaze unless noted otherwise and have a nail with a brass washer stamped "LS 2648" right side center for distance measurements.

Painted 6 ins. red bands and added Bearing Tree (54-3) and Land Survey Monument (54-9) signs as needed to all bearing trees.

Auto C/A geographic position: 45°04'44.1" N

Lat.

Long. 118°05'07.4" W

I hereby certify that the corner is monumented and accessories taken as described, using a Warren Knight staff compass, set with 15° East declination, and steel tape on August 2, 2014.

Witnesses: Brenda Johnson and Jon Howells

REGISTERED **PROFESSIONAL** LAND SURVEYOR

# *D*eceased

**OREGON** JANUARY 18, 1994 RON C. WALTER 2648

Renewal Date: June 30, 2016

**REGISTERED PROFESSIONAL** LAND SURVEYOR

OREGON July 22, 1977
WILLIAM R. WELLS 1106

Willi R. Wells

Renewal Date: June 30, 2016

UNION COUNTY SURVEYOR			
Date Received 2/25/15			
Date Filed 2/25/15			
By W. Chhi			
File No. <u>055-201512</u>			

NOTE: See "Explanation for Successor Certifying Surveyor" statement in Narrative of Record of Survey, CS 010-2015, filed concurrently with this Land Corner Record.