


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Index File No. A-9

**History of original corner establishment:**

Corner was originally established by W.B. Barr, under GLO contract No. 338 in September, 1881. Surveyor General's notes state: "Set post 4 ft. long, 4 ins. square, 18 ins. in the ground for cor. secs. 4 and 5. From which: A Pine 10 ins. diam. bears S25°W, 53 lks. dist. mkd. T6SR38ECCS5 BT. A Pine 15 ins. diam. bears S72PE, 50 lks. dist. mkd. T6SR38ECCS4 BT."

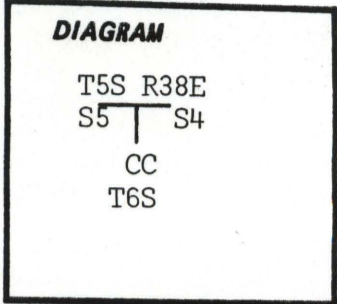


**Description of corner evidence found:**

Found 3" X 18" post with visible scribing, laying on the ground. Both BTs in good condition. At a point measured to 34" Pine S71°E, 33.4 ft. Blaze still partially open and some letters visible. A 28" Pine bears S26°W, 34.3 ft. Painted 6" red band around BTs.

Standard corner is 1979 brass cap 75" West.

**Description of monument and accessories | established to perpetuate the original location of this corner:**

Set 2 1/2" X 30" galvanized pipe and brass cap marked: Set pipe 24" in the ground and mound of stone around to cap. BTs have 54-3s and CZ tags, 54-4s on back side of both BTs. Placed 54-4 on steel fence post 5' South of the corner.

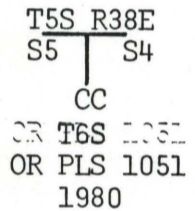

I hereby certify that the above corner monument was reestablished as herein described.

May 20, 1980

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*Barry B. Barbour*

OREGON  
OCT. 17, 1978  
BARRY B. BARBOUR  
1051

Office of.....County Surveyor..... County of.....Union.....

State of.....Oregon....., I hereby certify that the within instrument was filed in this office for record on the 3<sup>rd</sup> day of.....July....., 1980

..... by .....  
(COUNTY OFFICIAL) (DEPUTY)

Form R6-7100-57 (9/71)

**UNION COUNTY SURVEYOR**

Date Received \_\_\_\_\_

★ GPO—798-276

Date Filed \_\_\_\_\_

By \_\_\_\_\_

File No. 7847-84R