(Phase II)

Traverse book Numbers


Remonumentation Book

SIGNATURE

DATE

l, 2, 3, 4 and 5

Numbers I and 2

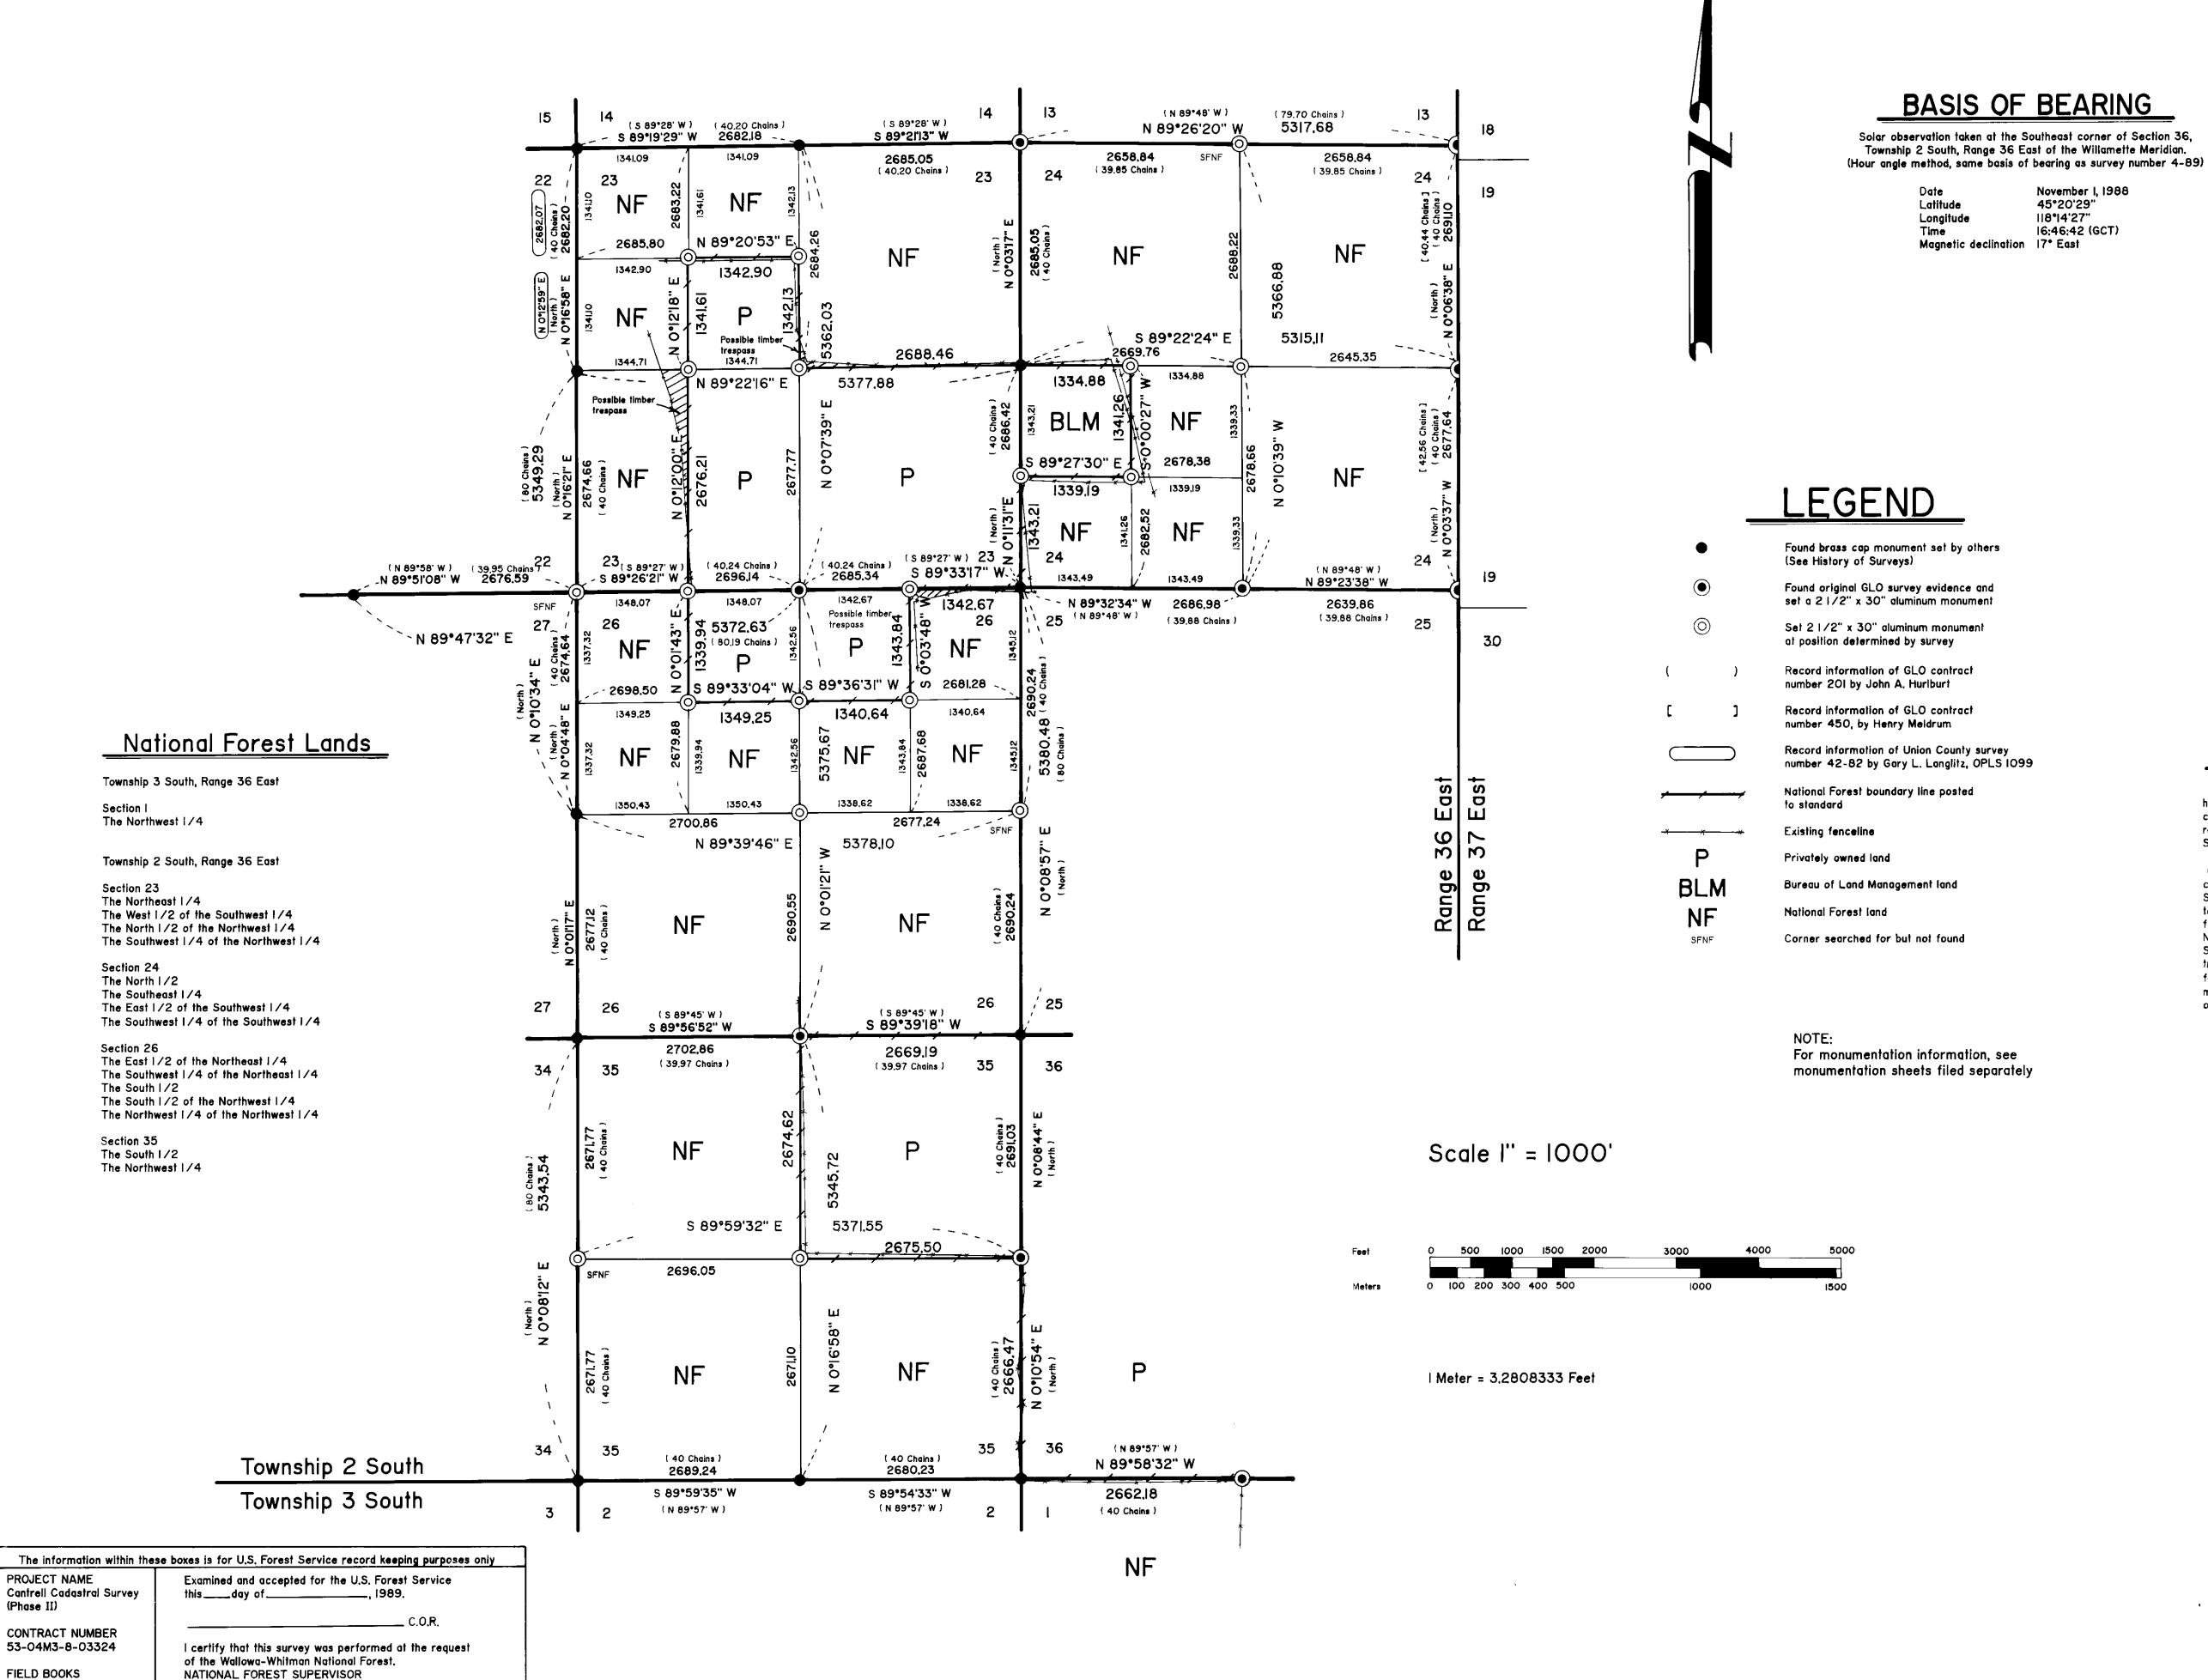

History of Surveys

The exterior and subdivisional corners of Township 2 South, Range 36 East of the Willamette Meridian were originally established by John A. Hurlburt under GLO Contract number 201, dated August 5,

The East line of Township 2 South, Range 36 East was retraced by Henry Meldrum under GLO Contract number 450, dated June II,

The Northwest corner of Section 23 was remonumented from original GLO survey evidence by James G. Voelz, OPLS 381, in 1969.

The North 1/4 corner and Southeast corner of Section 23 was remonumented from original GLO survey evidence by James G. Voelz, OPLS 381, in 1970.

The East and West 1/4 corners of Section 23, the West 1/4 corner, Southeast and Southwest corners of Section 26, and the South 1/4 corner and Southeast corner of Section 35 were remonumented from original GLO survey evidence by A. Joseph Garrison, BLM Group Number 350, in 1975, under instructions dated May 3, 1957.

The South 1/4 corner of Section 22 was remonumented from original GLO survey evidence by Gary L. Langlitz, OPLS 1099, on June 17, 1981.

The West line of the Northwest 1/4 of Section 23 was retraced by Gary L. Langlitz, OPLS 1099, on Union County survey number 42-82.

The Southwest corner of Section 35 was remonumented from original GLO survey evidence by Dennis L. Gaylord, OPLS 1636, on

SURVEYOR'S STATEMENT

1, Duane I. Griffith, Registered Land Surveyor in the State of Oregon, hereby certify that this plat and the notes hereon, or attached, are a true and correct representation of the survey I made in May and June, 1989, at the request of the USDA Forest Service, in accordance with the statutes of the State of Oregon and with the articles of my contract.

I began this survey by retracing the external lines of the sections as shown. On all corners not found, it is evident they have been destroyed by logging or construction. I proportioned the lost corners as set forth in the BLM Manual of Surveying Instructions. I then subdivided the sections to the extent necessary to locate the National Forest boundary line. I find the existing fencelines differ from the true property lines as shown. In the area of the West line of the Northwest 1/4 of the Southwest 1/4 of Section 23 and in the area of the Southwest corner of the Northeast 1/4 of Section 23, I find a possible timber trespass. These areas were recently logged and it appears the existing fencelines were used as the logging limits. It is possible that agreements were made concerning these existing fencelines. I find no other unusual conditions on this survey.

> Bagett, Griffith and Associates 2006 Adams Avenue LaGrande, Oregon

June 12, 1989.

REGISTERED **PROFESSIONAL** LAND SURVEYOR and Siffe DUANE I. GRIFFITH

UNION COUNTY SURVEYOR Date Received 7-51-89 Date Filed 8-8-89 BY G. LANGUTZ DEPUTY File No. 11-89

0/\(BAGETT - GRIFFITH & ASSOCIATES
1	LaGrande, Oregon
	MAP OF SURVEY
	Location of the National Forest boundary
	within Sections 23, 24, 26 and 35
	Township 2 South, Range 36 East
	of the Willamette Meridian
	UNION COUNTY, OREGON

SURVEYED FOR Wallowa-Whitman National Forest SURVEYED BY 5 & 6-89 Scale: |" = 1000' | Drawn by: R.G.R. 6-89